

TILLAMOOK COUNTY SURVEYORS OFFICE

Section Corner common to Sections 13 & 24, T.2S.,R.10W.,W.M.  
and  
Sections 18 & 19, T.2S.,R.9W.,W.M.

T 2 S  
R10W R9W  
S13|S18  
----+----  
S24|S19  
1990

I found a leaning 2" iron pipe with plug and tack set by W.E. Anderson on C.S. map #B-317 The position of this iron pipe was destroyed by cultivation of the pasture it is located in.

I set a 1 1/2" iron pipe with 3" Tillamook County Surveyors Brass Cap in a 10" concrete cylinder 18" deep from ties made on Tillamook County Surveyors map #B-1429.

-----  
History of found Monument

This corner is not an original corner. It was first reestablished by single proportioned in 1915 by Reitze, Storey, & Duffy Engineers on Tillamook County Surveyors map #F-19-25. This corner was apparently lost too, and reestablished by Robert Walker in 1949 on Tillamook County Surveyors map #B-156 using different information, such as an 80" Y. fir line tree called in the original notes 31.50 chains South. This corner was deemed incorrect by W. E. Anderson, past Tillamook County Surveyor, in approximately 1954 on Tillamook County Surveyors map #B-317, (also see calculation sheets in field note bin section 13 T.2S., R.10W.,W.M.), so he set a 2" iron pipe with wood plug and nail at the position which is now used and has been subsequently used by numerous surveys in this area.

Bearing Trees were established for the corner set by Robert H. Walker in Tillamook County Surveyors rewitness book 1 at page 95 by W.E. Anderson & Francis L. Smith on May 8, 1951, and retied as bearing trees to Andersons' corner in 1972 in Tillamook County Surveyors rewitness book 5 at page 218 as follows:

\*10" spruce S.45\*W. 78.5'; (Now 42" spruce S.43\*58'37"W. 77.08' rescribed B.T CS, old face is overgrown, it faces Walkers iron pipe).


\*40" spruce N.5\*W. 183.0'; (Now 45" spruce leaning heavily N.8\*40'W. 182.66' rescribed B.T on root flair, old face is overgrown).

\*Twin (schoolmar) spruce S.64 1/2\*E. 158.0'; (Now 79" rotten spruce stump S.62\*28'E. 157.4' face is overgrown).

2 1/2" O.D. iron pipe (Walkers position) S.14 1/2\*E 38', Andersons calculations sheets say S.14\*13'E. 38.27'; (Now S.13\*57'23"E. 38.33' I set in concrete for reference monument).

All angles and distances to rescribed bearing trees measured to nail with brass washer in new face between scribe marks "B" & "T".

\*indicates yellow metal Tillamook County location tag attached.

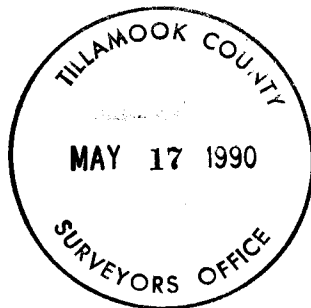

page 1 of 2

TILLAMOOK COUNTY SURVEYORS OFFICE

Rewitness and Field note books of reference

P-16 page 60 C.A.Dunn private surveys 1915  
Book 1 page 95 Rewitness by W.E. Anderson 1951  
Book 5 page 218 Rewitness by GWU 1972  
Book 53 page 278 survey for Tillamook Logging company 1899

Maps of Reference

F-19-25	1915	Reitze, Storey, & Duffy Engineers	
B-156	1949	Robert H. Walker	LS 150
B-317	1954 Apr.	W.E. Anderson	PE 1697
F-2-11	1962	W.E. Anderson	PE 1697
B-472	1963	Charles G. Collard	LS 376
B-644	1973	Karl F. Foeste	LS 849
B-688	1974	Lester E. Fultz	PE 4571
B-922	1980	Robert J. Olsen	LS 701
B-923	1980	Robert J. Olsen	LS 701
B-961	1981	Allan E. Duncan	LS 793
A-5783	1989	C. Wayne Cook	LS 1098
B-1429	1990	Allan E. Duncan	LS 793

---

Monument Location

This monument is located in an open pasture approximately 200' West of a farm lane and approximately 40' North of an old N-S fence line.

---

In the presence of Dan McNutt & Al Dvorak

April 1990

Title

REGISTERED  
PROFESSIONAL  
LAND SURVEYOR

*Allan E. Duncan, C.S.*

page 2 of 2

OREGON  
JULY 14, 1987  
ALLAN E. DUNCAN  
793



BOOK 6 461-B