
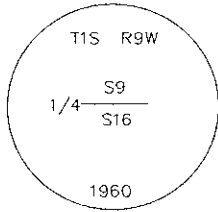


**OREGON PUBLIC LAND CORNER REPORT / RESTORATION REPORT**  
Tillamook County Surveyor's Office

|   |   |   |
|---|---|---|
| <b>SECTION:</b> The South one-quarter corner of Section 9   | <b>TOWNSHIP</b> 1 South   | <b>RANGE</b> 9 West   |
| <b>COUNTY:</b> Tillamook  |   | <b>DATE:</b> 11-14-11   |
| <b>CORNER DESIGNATION:</b> The One-quarter corner common to Sections 9 and 16, Township 1 South, Range 9 West, W.M., Tillamook County, Oregon.  | <b>(Please check one)</b>   |   |
|   | <input type="checkbox"/>  | Condition Report Only   |
|   | <input type="checkbox"/>  | Restoration   |
|   | <input checked="" type="checkbox"/>   | Rewitness   |
|   | <input type="checkbox"/>  | Unrecorded  |
|   | <input type="checkbox"/>  | Reset at surface  |
| <b>Previous Rewitnesses, Restorations and Surveys, etc:</b> Rewitness Card number 193, Rewitness Book 3, Page 155, Survey Map A-1099, Survey Map B-672, Tillamook County Survey Records.  |   |   |
| <b>Found Monument(s) and Accessories (Condition &amp; Source):</b> Found a 3" diameter B.L.M. cap sloping downhill and it appears the monument has been sliding down the steep slope over time. We used GPS to tie the found disturbed monument. We removed the badly leaning monument and reset the brass cap at the upright and uphill position for the North one-quarter corner for Section 9. We then placed a 12" diameter plastic cylinder and 120 pounds of concrete around the found monument. The cap is stamped as shown hereon.<br>GPS observation of the reset monument – Latitude = 45°29'30.58831" N, Longitude = 123°47'31.29226" W.   |   |   |
| <b>Monument Set (Procedures and Description):</b> It was determined that the found monument was disturbed and out of position due to the ground movement on the steep hillside. A GPS established control meridian was set along the existing logging road and was used as control to stake the position of the North One-quarter corner of Section 9. The grid bearing and distance between the two control monuments is North 73°56' 59" East 206.21'. The combined scale factor is 0.99990186; Convergence = -2°20'04.79045".<br>We found double-Alder that might be a possible bearing tree, but the tree has no visible marks and does not fit well with the BLM restoration recorded in Rewitness Book 3, Page 155. There was a metal location tag facing the logging road. The Alder bears South 7° West as shown on Rewitness Card Number 193 (12" Alder bears South 16° West 73 lks. Bark scribed "1/4S9BT" see Rewitness Book 3, Page 155). | <b>Sketch of Found Monument:</b><br> |   |
| <b>New accessories set:</b> Reset the found 72" hat section post North 1.2' from monument (was North 1.8' Rewitness Card #193). Set a 5/8" x 30" rebar with a red plastic cap stamped "TILLAMOOK CO SURVEY" 9' South of an existing East/West logging road –Latitude = 45°29'29.67792" N, Longitude = 123°47'30.77134 W. Set a 5/8" x 30" rebar with a red plastic cap stamped "TILLAMOOK CO SURVEY" 18' South of an existing East/West logging road in a pullout – Latitude = 45°29'30.32008" N, Longitude = 123°47'28.02422" W.   |   |   |
| <b>New Bearing Trees:</b> A 10" diameter Hemlock tree scribed "1/4 S9BT" bearing North 45° West 36.9'. A 9" diameter Cedar tree scribed "1/4S9BT" bearing North 4° West 34.7'.  |   |   |
| <b>Location &amp; Comments:</b> This corner is located approximately 75' North of a main logging road on a steep Southerly facing slope.  |   |   |
| <b>Firm / Agency</b><br>Address: TILLAMOOK COUNTY SURVEYOR'S OFFICE<br>201 Laurel Avenue<br>Tillamook, Oregon 97141   |   | <b>SURVEYOR'S SEAL</b>  |
| <b>Party Chief:</b> Joe Jensen, PLS 60067, Survey Supervisor;<br>Deputy County Surveyor.  |   |  |
| <b>Notes:</b>   |   |   |
| <b>Witnesses:</b> Danny R. McNutt, PLS 49230, Tillamook County Surveyor; Michael R. Rice, L.S.I. 16723, Survey Technician   |   | RENEWAL DATE: 06-30- 2013   |

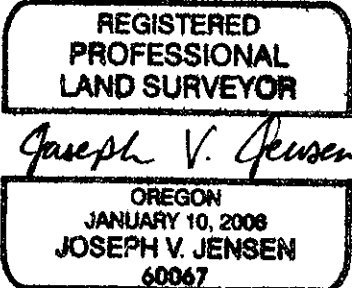