
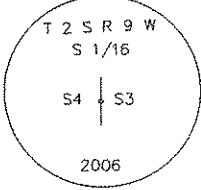


**OREGON PUBLIC LAND CORNER REPORT / RESTORATION REPORT**  
**Tillamook County Surveyor's Office**

<b>SECTION:</b> The South One-sixteenth corner of Section 4	<b>TOWNSHIP</b> 2 South	<b>RANGE</b> 9 West	
<b>COUNTY:</b> Tillamook		<b>DATE:</b> 10-27-06	
<b>CORNER DESIGNATION:</b> The south one-sixteenth corner of Section 4, Township 2 South, Range 9 West, W.M., Tillamook County, Oregon.		<b>(Please check one)</b>	
		<input type="checkbox"/>	Condition Report Only
		<input type="checkbox"/>	Restoration
		<input checked="" type="checkbox"/>	Rewitness
		<input type="checkbox"/>	Unrecorded
		<input checked="" type="checkbox"/>	Reset at surface
		<input type="checkbox"/>	Referenced Out
<b>Previous Rewitnesses, Restorations and Surveys, etc.:</b> See map B-301, A-3580, Tillamook Survey Records.			
<b>Found Monument(s) and Accessories (Condition &amp; Source):</b> Found a bridge spike approximately 6" below new asphalt at the record location of the South 1/16 of Section 4, Township 2 South, Range 9 West, as shown on map A-3580. Also found a 1-1/2" diameter iron pipe in good condition described as being a witness corner to the sixteenth corner on map A-3580. The found bridge spike is located approximately one foot West of the as-built centerline of Brickyard County Road and is lying beneath the road surface due to asphalt paving.			
<b>Monument Set (Procedures and Description):</b> I set a 2" diameter Tillamook County Surveyor brass disk in concrete at road surface.		<b>Sketch of Set Monument::</b> 	
<b>New accessories set:</b> I set a 5/8" rebar with yellow plastic cap stamped "TILLAMOOK CO. RANDOM" in the Port of Tillamook Bay field, west of Brickyard County Road, at a distance of 28.94' from the newly set brass disk and on-line with the found bridge spike and the found 1-1/2" iron pipe. The 1-1/2" iron pipe being located 25.01' East of the 1/16 corner as shown on map A-3580.			
<b>New Bearing Trees:</b> No bearing trees were set.			
<b>Location &amp; Comments:</b> The new surface monument is located approximately 1' West of the as-built centerline of Brickyard County Road.			
<b>Firm / Agency</b> Address: TILLAMOOK COUNTY SURVEYOR'S OFFICE		<b>SURVEYOR'S SEAL</b>	
<b>Party Chief:</b> Joe Jensen, PLS 60067, Survey Supervisor		 <i>Danny R. McNutt</i>	
<b>Notes:</b>			
<b>Witness:</b> Danny R. McNutt, PLS 49230, Tillamook County Surveyor			

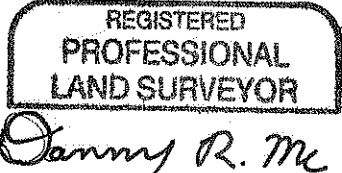