

CHAINS

1400.0 Point on true line set temporary stake.
Adjustment from temporary stake 1389.5 set
South 10.5 ft. West 4.8 ft.
Established direction of true line.

Beginning at CN 1/16 cor. of Sec. 24
East on a random line through the center of the NE $\frac{1}{4}$ of Sec. 24.

1268.8 Set temporary stake.

2490.3 The N 1/16 cor. to Sec. 24 & 19 bears S 88°38' E a distance of
125.6 ft.

Relative to the random line the true line bears S 89°56' E a
distance of 2615.9 ft.

Adjustment to true line from temporary stake 1268.8 set East 29.0
ft., South 1.5 ft. and established direction of true line.

1297.8 Intersect the true line S 0°11' W through the center of the
NE $\frac{1}{4}$ at 1314.6 ft.

At the center of the NE $\frac{1}{4}$ Sec. 24.

Set 1 $\frac{1}{2}$ inch iron pipe, 3 feet long, filled with charcoal, with
an Oregon State Board of Forestry bronze cap stamped: NE 1/16
S24 1949 199.


from which:

A fir snag 48" in diam., bears S 87° E, a distance of 57.8
feet, scribed: NE 1/16 S 24 199 BT.

Placed a metal location poster on this snag and marked it: Sec
24 T1N R6W NE 1/16 55.3 ft. N 87° W.

Placed a mound of stone around corner.

The above work done by Don Davis, transitman, Bruce Thomas and
Wayne Frank, chainmen, Douglas Rogers, flagman, under my direction.

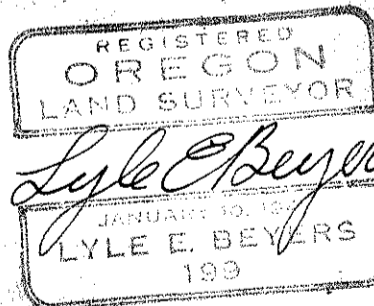

Lyle E. Beyers
Forest Engineer