

CHAINS

RESTORED CORNER FOR OREGON STATE BOARD OF FORESTRY

Section corner common to sections 13, 14, 23, and 24, T2N R7W, WM., Tillamook County, Oregon.

ORIGINAL

16"x12"x10" basalt stone, now missing, from which a:

20" Hemlock bears N72E 21 lks; now 28" stump N73E, exposed scribe marks along edge of old face which had been chopped out.

18" Hemlock bears S35E 66 lks; now 30" stump S29°30'E, old face chopped out.

6" Hemlock bears S51W 63 lks; now missing.

21" Fir bears N66W 41 lks; now 24" stump N65W, old face chopped out.

(Also found a 27" Fir stump N86°30'W 610.7' to the center of the stump from the original corner scribed R7W S14 BT. This BT does not conform with the calls of the original field notes, nor does its position with regard to topography conform with that of the corner described in the original field notes.)

RESTORED CORNER AND WITNESSED CORNER POINT

Set 1½"x36" galvanized iron pipe with 3" bronze cap marked "OREGON STATE BOARD OF FORESTRY T2N R7W S14 S13 S23 S24 1952 2311," 2½' in ground. Raised mound of stone around corner pipe, from which a:

42" Fir stump bears N55E 26.5'; scribed T2N R7W S13 BT.

30" Fir stump bears S47E 32.9'; scribed T2N R7W S24 BT RE 2311.

36" Fir stump bears S74W 44.2'; scribed T2N R7W S23 BT.


32" Fir stump bears N75°45'W 17.8'; scribed T2N R7W S14 BT.

Placed an Oregon State Board of Forestry metal location poster on 30" Fir stump BT and marked it: Sec 24 T2N R7W Sec Cor 32.9 Ft. N47W.

Dated December 5, 1952

This corner was restored by
UNDER MY DIRECTION.

Don D. Davis
Don D. Davis Assistant Forest Engineer

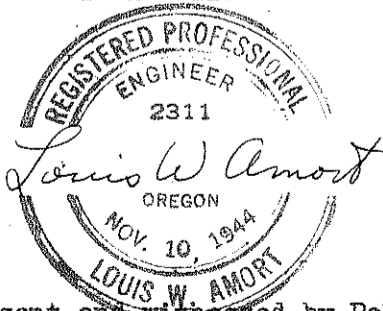

Present and witnessed by Robert A. Young, compassman, and Gerald M. Schwalen, Chainman