

CHAINS

RESTORED CORNER FOR OREGON STATE BOARD OF FORESTRY

One-quarter corner common to sections 3 and 34, T1 and 2 N R7W, W1., Tillamook County, Oregon.

ORIGINAL

Var. 22°E.

12"x10"x8" stone, now slightly out of place, marked #, from which a:

18" Hemlock bears N23E 38 lks; now 22" stub N27E, parts of scribe marks BT exposed.

30" Hemlock bears S28E 83 lks; now 48" rotted and burnt stub 12' high S24E 55.9'.

RESURVEY by Oregon State Board of Forestry February 20, 1951. Var. 18°E

1½"x36" galvanized iron pipe with 3" bronze cap marked "OREGON STATE BOARD OF FORESTRY 1/4 S34 S3 1951 199," now pulled up and laying on ground out of place.

44" Cedar snag bears N64W 71.5'; now down 44" snag, scribe marks 1/4 S BT 199 plainly visible.

29" Fir stub bears S61W 43.5'; now missing.

RESTORED CORNER AND WITNESSED CORNER POINT

Var. 22°E

Reset 1½"x36" galvanized iron pipe with 3" bronze cap marked "OREGON STATE BOARD OF FORESTRY 1/4 S34 S3 1951 199," 2½' in ground. Placed 1/4 corner stone on south edge of pipe and raised mound of stone around corner pipe, from which a:


60" Fir stump bears N45E 60.2'; scribed 1/4 S34 BT RE 2311.

50" Fir stump bears S60°30'W 88.9'; scribed 1/4 S3 BT.

Placed an Oregon State Board of Forestry metal location poster on 60" Fir stump BT and marked it: Sec 34 T2N R7W 1/4 Cor 60.2' S45W.

Dated December 5, 1952

This corner was restored by Don D. Davis under my direction. Don D. Davis Assistant Forest Engineer

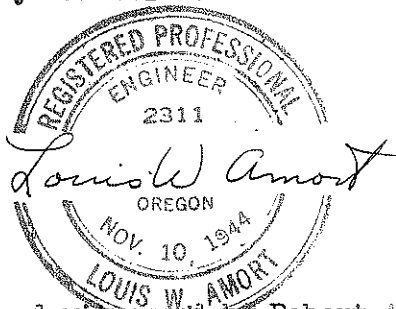

Present and witnessed by Robert A. Young, Compassman and Gerald M. Schwalen, Chainman.