


CERTIFICATE OF RECORD OF LAND CORNER MONUMENT

History of original corner establishment:

Corner established by W. P. Wright in 1882 under G. L. O. contract No. 442. For the corner Wright set a scribed post, from which he scribed four bearing trees: 72" Fir brs. N 40° W 59 lks. 24" Hem. brs. N 33° E 42 lks. 12" Hem. brs. S 3° E 12 lks. 10" Hem. brs S 74° W 55 lks.

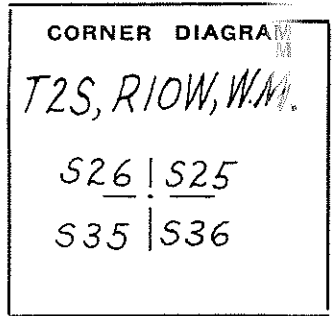

In County Survey Book 3, Page 301, C. G. Collard, L.S. 376, Reports: On May 8, 1969, I found the 10" Hemlock (now a rotting stump) with a scribed S-35-BT" plainly evident. the 72" Fir (also a rotting stump) is properly located in relation to the corner, but no face or marks are found. From these original bearing trees I set a 3/4" iron pipe with 3 inch brass cap for the corner. I marked new bearing trees as follows: 12" Fir brs. N 54° E 26.8 ft. scribed BTS25. 20" Fir brs. S 72° E 45.3 ft. scribed BTS36-376. 10" Fir brs. S 18° W 25.2 ft. scribed BTS35. 14" Hemlock brs. N 70° W 27.9 ft. scribed BTS26-376"

In approx. 1915 C. A. Dunn reports resetting this corner from distances, "Reset from dist." Dunn then gives bearings to the following B.T's: 12" Hemlock S01° E. 32" Hemlock S72° 30' W. 84" Fir N39° 30' W. 12" Hemlock N 33° E. See County Survey Book P-16, Page 49.

Description of corner evidence found:

I found Collard's brass cap monument and all four of his bearing trees as reported by him in 1969. I also found the original S.W. and N.W. bearing trees. The S.W. B.T. is now a 18" Hem. stump with scribing visible. The N.W. B.T. is now a 7 foot fir stump with original scribes no longer visible. Collard has accidentally set his brass cap 35 links from the original S.W. B.T. instead of 55 links as reported by Wright; and as a result of this error the original N.W. fir B.T. brs. N 20° W instead of N 40° W as reported by Wright.

I removed Collard's brass cap monument and re-set it at the original record distances and bearings from found two original bearing trees. From this brass cap monument the two original bearing trees and Collard's bearing trees bear as follows: Stump remains of Original Fir brs. N 40° W 38.9 ft. Stump remains of original Hemlock brs. S 74° W 36.3 ft. to face. 12" Fir bears N 36° E 12.9 ft. to face. 20" Fir brs. S 52° E 34.8 ft. to face. 10" fir brs. S 38° W 36.5 ft. to face. 16" Hemlock brs. N 81° W 41.3 ft. to face.

Description of monument and accessories I established to perpetuate the original location of this corner:

B-731
B-138

I, K. F. Foeste, Hereby certify the above corner was restored as herein described in October, 1976.

REGISTERED
PROFESSIONAL
LAND SURVEYOR

Karl F. Foeste

OREGON
JULY 12, 1968
KARL F. FOESTE
0849

Witnesses:

Harold A. Engberg
Allen F. Hofmann

Recorded in the office of _____ Surveyor _____, County of Tillamook

State of Oregon, I hereby certify that the within instrument was filed in this office

for record on the 15th day of December 1976

[Signature] (county official) by _____ (deputy)

KARL F. FOESTE, Registered Professional Land Surveyor of the State of Oregon