

TILLAMOCK

County

T 3 N, R 10 W, W.M.

Corner Code No.

Segregated Surveys:

Name: 1/4 Cor. Between Sec's. 25, T3N., R10W., & 30, T3N., Corner No.:
R9W., W.M. DLC. HES. Tract. Mining Claim, Indian Allotment, Federal Reserve. Townsite.

1. History of Corner Establishment and Subsequent Restoration:

Original: Set post of 1/4 corner, from which; A Hemlock, 35" dia. bears S72 W 5lks.
A Hemlock, 33" dia. bears S58 E 5lks.

Subsequent: Markham; Set 1/2" iron pipe and two bearing trees;
June, 1955 Fir 9"dia. N83 E 17.7ft.
Fir 11"dia. N88 W 40.6ft.

J.L. Carlich; Set 3" C.Z. Brass Cap from which;
D. Fir 12"dia. S22 45'E 32.76ft.
D. Fir 23"dia. S40 58'W 40.35ft.
This B.T. is bark scribed on S.W. side by Markham for 1955 NE BT.

2. Description of Evidence Found:

I found a 3/4"x36" galvanized iron pipe with 3" Brass Cap pulled out of the ground and laying to the east of the corner position. The 12" Douglas Fir bearing tree as set by J.L. Carlich bearing S22 45'E 32.76ft. has been destroyed by cat logging. The 23" Douglas Fir bearing tree bark scribed by Markham and rescribed in the proper position by J.L. Carlich bearing S40 58'W 40.35ft. was felled with the saw cut destroying all but the very bottom of the face as scribed by Carlich. The 1/2" iron pipe as set by Markham for the 1/4cor.(bearing S53 14'W 55.10ft. from the true position)had been undisturbed.

3. Describe Monument, Accessories and Corollary Data to Perpetuate this Corner Location. Diagram corner and indicate meridian and reference to map of record. Surveyor's Field Book No. Page No. Date of work

February 27, 1981.
I reset the found 3/4"x36" galvanized iron pipe with 3" Brass cap in its proper position from the remaining Bearing Tree and the 1/2" iron pipe set by Markham; from which I scribed one new Bearing Tree which is a 13" dia. Spruce stump with face marked "BT" (no room for further scribes)bearing S10 E 22.05ft. from the reestablished postion for the 1/4 corner.


Oregon Coordinate System: Zone, Y, X
Order Accuracy. Derived From:
Pin Pointed on Photo No. Date Located at

SURVEYOR'S CERTIFICATE

This corner record correctly represents work performed by me or under my direction in compliance with the provisions of ORS 209.250 Laws of 1956. Date

Signature

Certificate No.

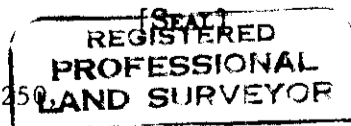

Robert J. Olsen
OREGON
JULY 8, 1985
ROBERT J. OLSEN
701