

TILLAMOOK COUNTY SURVEYORS OFFICE

Section corner common to sections 10,11,14,& 15, T.1N.,R.7W.,W.M.

T1N R7W  
S10|S11  
----+----  
S15|S14  
1953  
2311

I found a 1 1/2" iron pipe with a 3" O.S.B.F. bronze cap, I set a 10" concrete cylinder around the found iron pipe. (See Tillamook County Surveyors rewitness book 2 page 293).

-----  
History of found Monument

I found this monument to be as reported on the above said rewitness, and the accessories found and/or set at that time to now be as follows:

Original 23" healock N.37\*W. 44 lks., reported as a 30" down stub uprooted, face rotted and burned out; (Now only a root hole with a few rotten chunks remaining).

Original 28" healock N.45\*E. 34 lks., reported as a 35" 20 ft. high stub, face and scribes burned and rotted off; (Now a rotten stub 2' high).

Original 13" healock S.48\*E. 40 lks., reported as a 20" stump 6" high, 10 ft. section downhill with BT scribes, (Now just a little rot remaining).

Original 9" healock S.21\*W. 48 lks., reported as an 8", down, and out of place, BT scribes; (Now gone).

36" fir snag N.21\*30'W. 64.4'; (found, now a stump N.26\*W. 64.4' scribing visible).

72" fir stump N.34\*E. 49.6'; (found, okay, 1988 O.D.F. yellow location poster attached, scribing visible).

43" fir stump S.63\*W. 52.8'; (found, okay, scribing visible).

28" fir stump S.12\*E. 41.9'; (found, okay, 1953 O.S.B.F. yellow location poster attached, scribing visible. This bearing tree is located on the top of a spur ridge course S.55\*W. X N.55\*E.)

4"X4"X48" white cedar post 2' North of pipe; (found, okay).

4"X4"X48" white cedar post 468' North and 18' West of corner, on SW shoulder of road; (not found).

Page 1 of 2



TILLAMOOK COUNTY SURVEYORS OFFICE

---

New Accessories

\*13" fir S.56\*E. 10.45', scribed T1NR7WS14B.TCS

\*21" fir S.62\*W. 16.55', scribed T1NR7WS15B.TCS

\*15" fir N.32\*E. 4.09', scribed S11B.TCS

\*72" light hat section post 1.5' North

All of the distances to the new bearing trees were measured to a finish nail with a Tillamook County Surveyors brass washer in the face between the B and the T.

\* Indicates yellow Tillamook County corner tag affixed.

---

Surveys of reference

A-639            1956            Arnold G. Gibson LS 359  
A-335            1949            D.E. Bosworth LS 82  
Field note book 69 at pages 46-50 and 139-143 Wilson River Highway 1932.

---

Monument Location

This corner is located approximately 300' SW of Ben Smith Creek Road and 40' Easterly of an alder covered cat grade on a steep westerly slope. I attached a Tillamook County Surveyors yellow location poster to a 30" fir on the Westerly side of Ben Smith Creek Road approximately N.55\*E. 300' slope distance, along the top of a spur ridge, of the O.S.B.F. 1953 SE B.T.


Due to hostile natives, yellow jacket bees, a 12" fir N.27\*W. approximately 12' was not scribed, leaving no new bearing tree in the NW quadrant.

---


In the presence of Dan McNutt & Al Dvorak

July 1990

Title

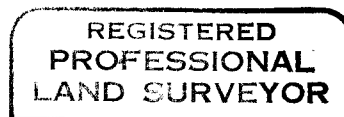

*Allan E. Duncan, C.S.*

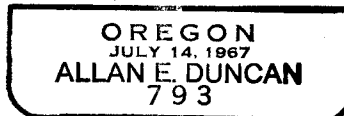

Page 2 of 2