
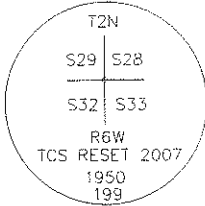


**OREGON PUBLIC LAND CORNER REPORT / RESTORATION REPORT**  
Tillamook County Surveyor's Office

<b>SECTION:</b> the SE corner of Sec. 29, T2N, R6W	<b>TOWNSHIP:</b> 2 North	<b>RANGE:</b> 6 West
<b>COUNTY:</b> Tillamook		<b>DATE:</b> 10-26-07
<b>CORNER DESIGNATION:</b> The Section corner common to Sections 29, 28, 32, and 33, Township 2 North, Range 6 West, W.M., Tillamook County, Oregon.		<b>(Please check one)</b>
		<input type="checkbox"/> Condition Report Only
		<input checked="" type="checkbox"/> Restoration
		<input type="checkbox"/> Rewitness
		<input type="checkbox"/> Unrecorded
<b>Previous Rewitnesses, Restorations and Surveys, etc.:</b> Rewitness Book 2, Page 40, Tillamook County Survey Records. BLM Field Note Volume: OR-R0415 Page: 0336.		<input type="checkbox"/> Reset at surface
<b>Found Monument(s) and Accessories (Condition &amp; Source):</b> We found no monument at this location. The original monument set at this location was a 10" diameter Hemlock tree (now gone) marked by Elliott and Bonser under contract 667 dated April 27, 1897. The only remaining corner accessory is a rotting 38" diameter Douglas fir stump with visible axe marks at record position. Elliott's original survey notes are filed with the BLM as Field Note Volume: OR-R0415 Page: 0336. In 1950, Lyle K. Beyers, P.L.S. 199, set an iron pipe and 3" diameter Oregon State Board of Forestry brass disk stamped "T2N S29 S28 S32 S33 R6W 1950 199". The only remaining corner accessory is a 42" diameter x 5' tall Cedar snag with visible scribe marks at record position. In 1999, the Forest Grove office of the Oregon State Department of Forestry (OSDF) removed this corner monument due to the potential disturbance from a logging operation. The references they set when they removed the corner are described below. They did not reset the monument.		<input type="checkbox"/> Referenced Out
<b>Monument Set (Procedures and Description):</b> We reset the pipe and 3" diameter Oregon State Board of Forestry brass cap stamped as shown hereon. I placed a 12" diameter plastic cylinder around the monument and filled the cylinder with 160 pounds of concrete and placed a mound of stones around the cylinder. OSDF set spikes in the base of two trees as reference points to the removed monument. These references are unrecorded, yet are on file with the OSDF. The monument was reset by holding the record distances measured from said found reference points consisting of a spike set in the base of a found 19" (was a 14") diameter Douglas Fir tree which bears North 01° West 25.76' and a found 26" (was a 22") diameter Douglas Fir tree which bears South 53° East 53.29'.		<b>Sketch of Reset Monument:</b> 
<b>Other new accessories set:</b> Set a 72" Hat Section post with yellow metal location tag North 3.0'.		
<b>New Bearing Trees:</b> *A 19" diameter Douglas Fir tree scribed "T2NR6WS29BT" with a nail and brass washer stamped "T.C.Surv" set between the 'B & T' which bears North 1° West 25.9'. *A 19" diameter Douglas Fir tree scribed "T2NR6WS32BT" with a nail and brass washer stamped "T.C.Surv" and set between the 'B & T' which bears South 28° West 42.4'. *A 26" diameter Douglas Fir tree scribed "T2NR6WS33BT" with a nail and brass washer stamped "T.C.Surv" and nail set between the 'B & T' which bears South 56° East 53.4'. *A 17" diameter Alder tree scribed "T2NR6WS28BT" with a nail and brass washer stamped "T.C.Surv" and nail set between the 'B & T' which bears North 24° East 28.0'. * INDICATES TILLAMOOK COUNTY YELLOW METAL LOCATION POSTER TAG ATTACHED.		
<b>Location &amp; Comments:</b> This corner is located approximately 50 feet East of an existing logging road and in the middle of an old cat road.		
<b>Firm / Agency</b> Address: TILLAMOOK COUNTY SURVEYOR'S OFFICE		<b>SURVEYOR'S SEAL</b>   <i>Danny R. McNutt</i>
Party Chief: Joe Jensen, PLS 60067, Survey Supervisor		
Notes:		
Witness: Danny R. McNutt, PLS 49230, Tillamook County Surveyor; Randy Wilson, Survey Tech.		

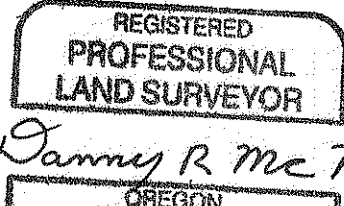