
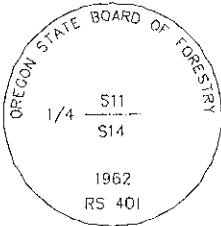


OREGON PUBLIC LAND CORNER REPORT / RESTORATION REPORT
Tillamook County Surveyor's Office

SECTION: 11	TOWNSHIP 3 South	RANGE 10 West	
COUNTY: Tillamook		DATE: 4-20-09	
CORNER DESIGNATION: The Quarter Corner common to Section 11 and Section 14.		(Please check one)	
		<input type="checkbox"/>	Condition Report Only
		<input type="checkbox"/>	Restoration
		<input checked="" type="checkbox"/>	Rewitness
		<input type="checkbox"/>	Unrecorded
		<input type="checkbox"/>	Reset at surface
Previous Rewitnesses, Restorations and Surveys, etc: BLM Field Notes Volume: OR-R0272 Page 129 (GLO 3S10 Page 22) (1882), Map A-1008 (1962), Map A-1475 (1967), Map B-1085 (1982), Map B-1144 (1983), Tillamook County Survey Records.			
Found Monument(s) and Accessories (Condition & Source): Found a 3" brass cap in good condition, flush, with a rock collar. The monument is stamped as shown hereon. Found remains of a white cedar post lying next to the monument. Tied the monument directly using GPS established control. The Oregon North Zone State Plane in NAD 83/91 grid coordinate position for the monument is N = 620091.355, E = 7334538.572, U.S. Feet. (G.L.O.) – Did not find the (6" diameter Hemlock bearing S 22° W 24 lks.). (G.L.O.) – Did not find the (8" diameter Hemlock bearing N 71° E 12 lks.). (Map A-1008) – Found rotten Hemlock Stump (was 33" diameter), 4' tall, bears (S 6° W 8.7'), scribing partially visible. (Map A-1008) – Found rotten Hemlock Stump (was 15" diameter), 5' tall, with tag, leaning east, bears (N 25° E 33.3'). () Indicates record information from Tillamook County Survey Records.			
Monument Set (Procedures and Description): Not applicable.		Sketch of Found Monument: 	
New accessories set: Set 60 lbs. of concrete in a 12" diameter cylinder around monument. Set a hat section post with a yellow metal location tag North 3.0' from monument.			
New Bearing Trees set: *14" diameter Fir bears N 38° E 116.1', scribed, "T3S R10W S11 BT", tagged and painted. *14" diameter Fir bears S 47° E 103.7', scribed, "T3S R10W S14 BT", tagged and painted * Indicates yellow metal location tag affixed to new bearing tree. All new bearing trees have a nail and aluminum washer marked, "Till. Co. Surveyor", in face of blaze, between the scribed B and T.			
Location & Comments: Corner is located in a clear-cut, approx. 100' westerly of a north/south running timber line and 100" northerly of an east/west running timber line, on a hillside.			
Firm / Agency Address: TILLAMOOK COUNTY SURVEYOR'S OFFICE 201 Laurel Avenue Tillamook, Oregon 97141		SURVEYOR'S SEAL	
Party Chief: Joe Jensen, P.L.S. 60067, Survey Supervisor			
Notes:			
Witnesses: Danny R. McNutt, P.L.S. 49230, Tillamook County Surveyor. Michael R. Rice, L.S.I. 16723, Survey Technician			

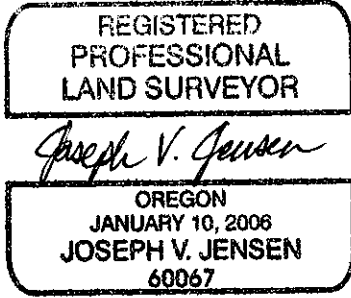