
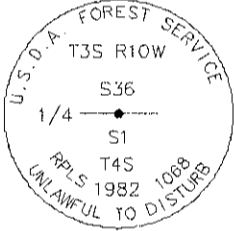


OREGON PUBLIC LAND CORNER REPORT / RESTORATION REPORT
Tillamook County Surveyor's Office

SECTION: 36	TOWNSHIP 3 South	RANGE 10 West	
COUNTY: Tillamook		DATE: 8-07-09	
CORNER DESIGNATION: The Quarter Corner common to Section 36, T.3S., R.10W. and Section 1, T.4S., R.10W., W.M.		(Please check one)	
		<input type="checkbox"/>	Condition Report Only
		<input type="checkbox"/>	Restoration
		<input checked="" type="checkbox"/>	Rewitness
		<input type="checkbox"/>	Unrecorded
		<input type="checkbox"/>	Reset at surface
		<input type="checkbox"/>	Referenced Out
Previous Rewitnesses, Restorations and Surveys, etc: BLM Field Notes Volume: OR-R0180 Page 73, (Tillamook County GLO Book 4S10 Page 12) (1879), Map B-505 (1965), Rewitness Book 5 Page 51 (1970), Rewitness Card #648 (1976), Map A-3005 (1976), Map A-3118 (1977), Map B-1057 (1982), Tillamook County Survey Records.			
Found Monument(s) and Accessories (Condition & Source): Found a 3 1/4" U.S. Forest Service Aluminum Cap, good condition and flush. The monument was set on Map B-1057 (1982). The monument is stamped as shown hereon. Found original limb post set in 1879, lying next to the monument. Found a carsonite post 2.0' West of the monument and re-set it 2.0' East of the monument. Found 1" Iron Pipe, 36" high, 1.5' South of the monument as re-set on Map B-1057. Tied the monument directly using GPS established control. The Oregon North Zone State Plane in NAD 83/91 grid coordinate is N = 598525.445, E= 7338545.268 U.S. Survey Foot. (G.L.O.) – Did not find the (72" dia. Fir bears N 53° W 121 lks. [79.86']). (G.L.O.) – Found large rotten Fir pile (was 72" dia.), bears (S 54° E 94 lks. [62.04']). (Book 5, Page 51) – Found rotten Fir Stump (was 8"), 1' tall, bears (N 22°30' W 16.58'). (Book 5, Page 51) – Found rotten Fir Stump (was 14"), 3' tall, bears (S 17° E 53.15'), with healed face and tag affixed. () Indicates record information, Tillamook County Survey Records. [] Indicates converted value from links to feet.			
Monument Set (Procedures and Description): Not applicable.		Sketch of Found Monument: 	
New accessories set: Set 120 lbs. of concrete in a 12" dia. cylinder around monument. Set 72" hat section post with a yellow metal location tag, 3.5' North from monument.			
New Bearing Trees set: *11" dia. Hemlock bears N 41° W 22.3' to face, scribed "T3S R10W S36 BT", tagged and painted. *6" dia. Douglas Fir bears S 36° E 13.0' to face, scribed "S1 1/4 BT", tagged and painted. * Indicates a yellow metal location tag affixed, and an aluminum nail w/ washer marked "Till. Co. Surveyor" between the scribed "B" and "T".			
Location & Comments: Monument is approx. 30' East of a grown over logging road.			
Firm / Agency Address: TILLAMOOK COUNTY SURVEYOR'S OFFICE 201 Laurel Avenue Tillamook, Oregon 97141		SURVEYOR'S SEAL	
Party Chief: Joe Jensen, P.L.S. 60067, Survey Supervisor			
Notes: Digital images were taken of the monument, the found bearing trees and the new accessories.			
Witnesses: Danny R. McNutt, P.L.S. 49230, Tillamook County Surveyor Michael R. Rice, L.S.I. 16723, Survey Technician			

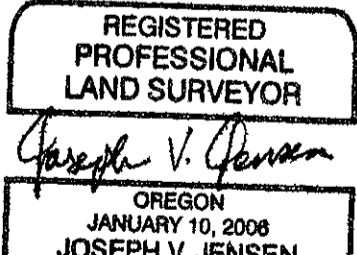