

OREGON PUBLIC LAND CORNER REPORT / RESTORATION REPORT
Tillamook County Surveyor's Office

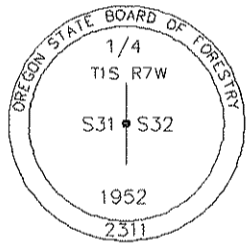
SECTION: Section 31	TOWNSHIP 1 South	RANGE 7 West
----------------------------	-------------------------	---------------------

COUNTY: Tillamook	DATE: 7-27-09
--------------------------	----------------------

CORNER DESIGNATION: The Quarter Corner common to Sections 31 and 32, T. 1 S., R. 7 W., W.M.	<table border="1" style="width:100%; border-collapse: collapse;"> <tr> <th align="center" colspan="2">(Please check one)</th> </tr> <tr> <td><input type="checkbox"/></td> <td>Condition Report Only</td> </tr> <tr> <td><input type="checkbox"/></td> <td>Restoration</td> </tr> <tr> <td><input checked="" type="checkbox"/></td> <td>Rewitness</td> </tr> <tr> <td><input type="checkbox"/></td> <td>Unrecorded</td> </tr> <tr> <td><input type="checkbox"/></td> <td>Reset at surface</td> </tr> <tr> <td><input type="checkbox"/></td> <td>Referenced Out</td> </tr> </table>	(Please check one)		<input type="checkbox"/>	Condition Report Only	<input type="checkbox"/>	Restoration	<input checked="" type="checkbox"/>	Rewitness	<input type="checkbox"/>	Unrecorded	<input type="checkbox"/>	Reset at surface	<input type="checkbox"/>	Referenced Out
(Please check one)															
<input type="checkbox"/>	Condition Report Only														
<input type="checkbox"/>	Restoration														
<input checked="" type="checkbox"/>	Rewitness														
<input type="checkbox"/>	Unrecorded														
<input type="checkbox"/>	Reset at surface														
<input type="checkbox"/>	Referenced Out														

Previous Rewitnesses, Restorations and Surveys, etc: BLM Field Notes Volume: OR-R0345 Page 158, (GLO Book 1S7 Page 69) (1891), Rewitness Book 2 Page 136 (1952), Tillamook County Survey Records and BLM Field Notes Volume: OR-R0683 Page 86 (2005).

Found Monument(s) and Accessories (Condition & Source): Found a 3" O.S.B.F. Brass Cap, good condition, protruding 0.5', with a carsonite post North 1.5' from the monument. The monument was set in Rewitness Book 2, Page 136 (1952) and is stamped as shown hereon. The original post is missing. The monument was tied conventionally using a single turn, doubling the angles off of GPS established control. The control used to occupy and tie the monument was generated by a single occupancy Static solution using the HARN Station "SISK" as a base receiver. The Oregon North Zone State Plane in NAD 83/91 grid coordinate is N = 661910.129, E = 7410160.942 U.S. Survey Feet or N = 45°26'26.69", W = 123°35'10.12" in geographic coordinates. (Oregon North Zone State Plane in NAD 83/96 geographic coordinate is N = 45°26'26.71", W = 123°35'10.13" per BLM Field Notes Volume OR-R0683 Page 86.)
 (G.L.O.) – Did not find the (Hemlock 16" dia. bears S 45° W 41 lks. [27.06']).
 (G.L.O.) – Found rotten Hemlock Stub (was 24" Hemlock bears S 23° E 88 lks. [58.08']).
 (Book 2, Page 136) – Did not find the (4" Fir bears S 89°30' E 34.0').
 (Book 2, Page 136) – Found (44" Fir Stump bears N 89° W 21.6'), scribing visible on rotten face.
 (OR-R0683, Page 86) – Found dead Fir Snag (11" dia.) bears (N 53° E), (26.7') to nail in side center, 26.0' to face, scrib. visible.
 (OR-R0683, Page 86) – Found 20" dia. Alder (was 19") bears (S 21° W), (18.9') to nail in side center, 17.5' to face, scrib. visible.
 () Indicates record information, Tillamook County Survey Records.
 [] Indicates converted value from links to feet.

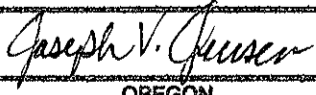
Monument Set (Procedures and Description): Not applicable.	Sketch of Found Monument: 
---	---

New accessories set: Set 120 lbs. of concrete in a 12" dia. cylinder around monument. Set 72" hat section post with a yellow metal location tag, 3.0' East from monument. Set a 3/4" Iron Rod with a center punch as an Occupy Point to conventionally tie the monument. The Iron Rod is in a recent clear cut and the Oregon North Zone State Plane in NAD 83/91 grid coordinate is N = 662046.922, E = 7410144.647 U.S. Survey Feet. Set a Magnail with a center punch as a Backsight Point to conventionally tie the monument. The Magnail is set in a low cut stump in a clear cut and the Oregon North Zone State Plane in NAD 83/91 grid coordinate is N = 662241.050, E = 7411125.166 U.S. Survey Feet.

New Bearing Trees set:
 *31" dia. Douglas Fir bears N 1° W 49.6', scribed "T1S R7W 1/4 S31 BT", tagged and painted.
 *Indicates an aluminum nail with washer marked, "Till. Co. Surveyor" set in the face between the scribed "B" and "T" and a yellow metal location tag attached to the bearing tree.

Location & Comments: Monument is located approximately 200' South of Eagle Hill Road and approximately 50' South of an E/W running tree line.

Firm / Agency Address: TILLAMOOK COUNTY SURVEYOR'S OFFICE 201 Laurel Avenue Tillamook, Oregon 97141
Party Chief: Joe Jensen, P.L.S. 60067, Survey Supervisor
Notes: Digital images were taken of the monument, the found bearing trees and the new accessories.
Witnesses: Danny R. McNutt, P.L.S. 49230, Tillamook County Surveyor Michael R. Rice, L.S.I. 16723, Survey Technician

SURVEYOR'S SEAL <div style="border: 1px solid black; padding: 5px; margin: 5px auto; width: 80%;"> REGISTERED PROFESSIONAL LAND SURVEYOR </div> <div style="text-align: center; margin: 5px auto;">  OREGON JANUARY 10, 2008 JOSEPH V. JENSEN 60067 </div> <div style="text-align: center; margin-top: 5px;"> RENEWAL DATE: 06-30-2011 </div>
--

