

OREGON PUBLIC LAND CORNER REPORT / RESTORATION REPORT
Tillamook County Surveyor's Office

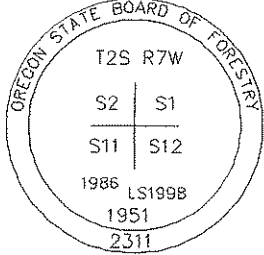
SECTION: Section 1	TOWNSHIP 2 South	RANGE 7 West
---------------------------	-------------------------	---------------------

COUNTY: Tillamook	DATE: 10-7-09
--------------------------	----------------------

CORNER DESIGNATION: The Section Corner common to Sections 1, 2, 11 and 12, T. 2 S., R. 7 W., W.M.	(Please check one) <input checked="" type="checkbox"/> Condition Report Only <input type="checkbox"/> Restoration <input type="checkbox"/> Rewitness <input type="checkbox"/> Unrecorded <input type="checkbox"/> Reset at surface <input type="checkbox"/> Referenced Out
--	---

Previous Rewitnesses, Restorations and Surveys, etc: BLM Field Notes Volume: OR-R0345 Pages 240- 241, (GLO Book 2S7 Page 10) (1891), Tillamook County Survey Records; Rewitness Book 2, Page 98 (1951), Rewitness Book 6, Page 284 (1986), Tillamook County Survey Records.

Found Monument(s) and Accessories (Condition & Source): Found a 3" O.S.B.F. Brass Cap, good condition, flush, with a rock collar. Found a white painted cedar post lying next to the monument. The monument was set in Rewitness Book 2, Page 98 (1951). The monument is stamped as shown hereon. The original post is missing.
 (G.L.O.) – Found rotten Hemlock Stub, (was 30"), 4' tall, bears S 16° E (S 18° E 27 lks. [17.82']), no markings visible.
 (G.L.O.) – Did not find the (8" Hemlock bears N 52 1/2° E 23 lks. [15.18']).
 (G.L.O.) – Did not find the (8" Hemlock bears N 52 1/2° W 41 lks. [27.06']).
 (G.L.O.) – Found rotten Fir stub, (was 26"), 9' tall, (bears S 60 1/2° W 53 lks. [34.98']), no markings visible.
 (Book 2, Page 98) – Found rotten Fir Stump, (was 48"), 4'tall, (bears N 70° E 13.5'), no markings visible.
 (Book 2, Page 98) – Did not find the (38" Hemlock Stump bears N 72° W 18.5').
 (Book 6, Page 284) – Found 16" Fir, (was 11"), bears (S 65° E 26.8'), healed face and yellow metal location tag.
 (Book 6, Page 284) – Found 18" Fir, (was 13"), bears (S 07° W 21.5'), healed face and yellow metal location tag.
 (Book 6, Page 284) – Found 15" Fir, (was 10"), bears (S 85° W 21.9'), healed face and yellow metal location tag.
 (Book 6, Page 284) – Found 20" Fir, (was 12"), bears (N 11° W 14.8'), chopped out face, yellow tag missing.
 () Indicates record information, Tillamook County Survey Records.
 [] Indicates converted value from links to feet.

Monument Set (Procedures and Description): Not applicable.	Sketch of Found Monument: 
---	---

New accessories set: Set 120 lbs. of concrete in a 12" dia. cylinder around monument. Set 72" hat section post with a yellow metal location tag, 3.0' North from monument. Reset rock collar.

New Bearing Trees set:
 N/A

Location & Comments: Monument is located on a slope approximately 40' East of Murphy Grade Road and approximately 150' South of Cruiser Creek Road.

Firm / Agency Address: TILLAMOOK COUNTY SURVEYOR'S OFFICE 201 Laurel Avenue Tillamook, Oregon 97141
Party Chief: Joe Jensen, P.L.S. 60067, Survey Supervisor
Notes: Digital images were taken of the monument and the found bearing trees.
Witnesses: Danny R. McNutt, P.L.S. 49230, Tillamook County Surveyor Michael R. Rice, L.S.I. 16723, Survey Technician

SURVEYOR'S SEAL

REGISTERED
PROFESSIONAL
LAND SURVEYOR

Joseph V. Jensen

OREGON
JANUARY 10, 2008
JOSEPH V. JENSEN
60067

RENEWAL DATE: 08-30-2011

