
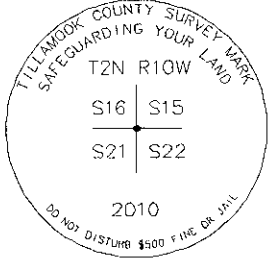


OREGON PUBLIC LAND CORNER REPORT / RESTORATION REPORT
Tillamook County Surveyor's Office

SECTION: SE Corner 16	TOWNSHIP 2 North	RANGE 10 West
COUNTY: Tillamook		DATE: 4-5-10
CORNER DESIGNATION: The Section Corner Common to Sections 15, 16, 21 and 22, T. 2 N., R. 10 W., W.M.		(Please check one)
		<input type="checkbox"/> Condition Report Only
		<input type="checkbox"/> Restoration
		<input checked="" type="checkbox"/> Rewitness
		<input type="checkbox"/> Unrecorded
		<input type="checkbox"/> Reset at surface
<input type="checkbox"/> Referenced Out		
Previous Rewitnesses, Restorations and Surveys, etc: BLM Field Notes Volume: OR-R0122 Page 135 (GLO 2N10 Pg. 31) (1873), Corner was proportioned and reestablished on Map B-380 (1957), Tillamook County Survey Records.		
Found Monument(s) and Accessories (Condition & Source): Found a 1 1/2" Iron Pipe with a nail and wood plug, down 0.5'. Tied the monument conventionally using an open ended traverse off of GPS established control. The Oregon North Zone State Plane in NAD 83/91 coordinate for the monument is N = 742547.492, E = 7331465.092 US Survey Foot. Latitude = 45°39'11.02844" N, Longitude = 123°54'20.58248" W. (Map B-380) – Found (Cedar Stump, 72" dia., 6' high, bears S 50° W 112.61'), scribing visible. (Map B-380) – Found rotten (Hemlock Stump, 24" dia., 30" high, bears S 87° E 32.04'), no marks visible. (Map B-380) – Found (Cedar Stump, 120" dia., 6' high, bears N 23°15' E 208.22'), scribing partially visible. (Map B-380) – Found (Spruce Stump, 84" dia., 15' high, bears N 64°45' W 177.70'), no marks visible. (Map B-380) – Found (4" X 5" X 60" Post, bears East 9.2'), scribing of sections on all sides of post. () Indicates record information, Tillamook County Survey Records.		
Monument Set (Procedures and Description): This monument has been in place since 1957. It was set as prescribed in the Manual of Surveying Instructions 1947 Edition by employing proper proportionate surveying methods by a Licensed Land Surveyor, John Carlich, PLS 287. Set reference stakes off of the found 1 1/2" Iron Pipe and set a 40" long iron pipe with a 3" diameter Tillamook County Brass Cap. The monument is stamped as shown hereon.	Sketch of Set Monument: 	
New accessories set: Set 120 lbs. of concrete in a 12" diameter cylinder around monument. Set a 72" hat section post with a yellow metal location tag 3.0' North of the monument.		
New Bearing Trees set: 14" dia. Spruce bears N 87° W 15.3', scribed "T2N R10W S16 BT", tagged and painted. 12" dia. Spruce bears N 62 1/2° E 24.8', scribed "T2N R10W S15 BT", tagged and painted. 16" dia. Spruce bears S 70° E 17.4', scribed "T2N R10W S22 BT", tagged and painted. All new bearing trees have a nail and aluminum washer marked, "Till. Co. Surveyor", in face of blaze, between the scribed "B" and "T", and a yellow metal location tag affixed.		
Location & Comments: Corner is located approx. 250' east of logging road #1150 on a heavily timbered slope.		
Firm / Agency Address: TILLAMOOK COUNTY SURVEYOR'S OFFICE 201 Laurel Avenue Tillamook, Oregon 97141		SURVEYOR'S SEAL 
Party Chief: Joe Jensen, P.L.S. 60067, Survey Supervisor		
Notes: Digital images were taken of the found monument, the new monument, the record bearing trees and new accessories.		
Witnesses: Danny R. McNutt, P.L.S. 49230, Tillamook County Surveyor Michael R. Rice, L.S.I. 16723, Survey Technician		

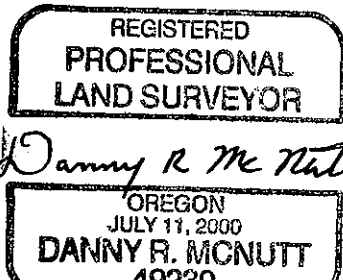