


OREGON PUBLIC LAND CORNER REPORT / RESTORATION REPORT
Tillamook County Surveyor's Office

SECTION: The East one-quarter corner of Section 15	TOWNSHIP 1 South	RANGE 9 West	
COUNTY: Tillamook		DATE: 10-17-11	
CORNER DESIGNATION: The East one-quarter corner for Section 15 Township 1 South, Range 9 West, W.M., Tillamook County, Oregon.		(Please check one)	
		<input type="checkbox"/>	Condition Report Only
		<input type="checkbox"/>	Restoration
		<input checked="" type="checkbox"/>	Rewitness
		<input type="checkbox"/>	Unrecorded
		<input type="checkbox"/>	Reset at surface
		<input type="checkbox"/>	Referenced Out
Previous Rewitnesses, Restorations and Surveys, etc: BLM Land Status and Cadastral Survey Records Field Note Volume: OR-R0575 Page: 216; Rewitness Book 3 Page 138; Map A-1100, B-530, Tillamook County Survey Records.			
Found Monument(s) and Accessories (Condition & Source): Found a 3" diameter B.L.M. brass cap upright and in good condition. I placed a 12" diameter plastic cylinder and 120 pounds of concrete around the monument. The monument is stamped as shown hereon. Found a very rotten stump/mound with a tree growing out of it (was 20" diameter Spruce scribed "1/4 S15 BT" bearing S 58-1/2° W 64-1/2 links. Rewitness Book 3, Page 138). Found a 49" diameter Hemlock tree with scribing visible and a yellow metal location tag at record position (was a 30" diameter Hemlock scribed "1/4 S15 BT" bearing N 11-1/2° W 44 links. Rewitness Book 3, Page 138).			
Monument Set (Procedures and Description: Not applicable.		Sketch of Found Monument:	
			
New accessories: Set a hat section post North 3.0'.			
New Bearing Trees set: A 16" diameter Hemlock tree scribed "T1SR9W1/4S15BT" which bears South 59° West 27.0' with a nail and aluminum washer stamped "TILL. CO. SURVEYOR" set between the scribed 'B & T'. A 20" diameter Spruce tree scribed "T1SR9W1/4S15BT" which bears North 75° West 44.0' with a nail and aluminum washer stamped "TILL. CO. SURVEYOR" set between the scribed 'B & T'.			
Location & Comments: This corner is located approximately 200' North and up a very steep rock face from an existing logging road.			
Firm / Agency Address: TILLAMOOK COUNTY SURVEYOR'S OFFICE		SURVEYOR'S SEAL <div style="border: 1px solid black; padding: 5px; display: inline-block; text-align: center;"> REGISTERED PROFESSIONAL LAND SURVEYOR </div> <i>Joseph V. Jensen</i> <div style="border: 1px solid black; padding: 5px; display: inline-block; text-align: center;"> OREGON JANUARY 10, 2008 JOSEPH V. JENSEN 60067 </div> RENEWAL DATE: 06-30-2013	
Party Chief: Joe Jensen, PLS 60067, Survey Supervisor and Deputy County Surveyor			
Notes: Digital images were taken of the monument and accessories.			
Witnesses: Danny R. McNutt, PLS 49230, Tillamook County Surveyor; Michael R. Rice, L.S.I. 16723, Survey Technician			

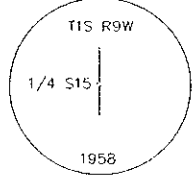