
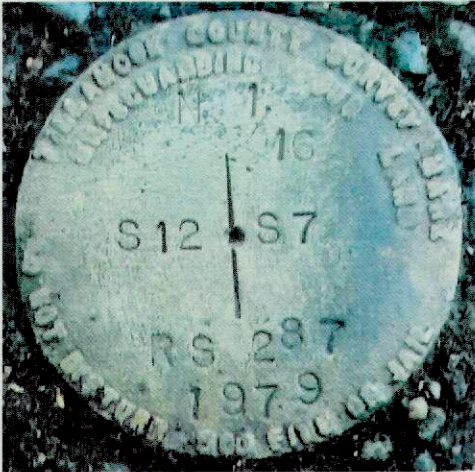
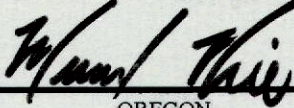


OREGON PUBLIC LAND CORNER REPORT / RESTORATION REPORT  
Tillamook County Surveyor's Office

BOOK 8 227

SECTION: 12 & 7	TOWNSHIP: 2 South	RANGE: 9 & 10 West
COUNTY: Tillamook	DATE: 4/17/2024	
CORNER DESIGNATION: The North 1/16 corner common to Sections 12, Township 2 South, Range 10 West; and Section 7, Township 2 South, Range 9 West; Willamette Meridian	(Please check one)	
	Condition Report Only	
	Restoration	
	<input checked="" type="checkbox"/> Rewitness	
	Unrecorded	
	Reset at surface	
	Referenced Out	
Previous Rewitnesses, Restorations and Surveys, etc... B-873 (1979), Rewitness Card #368 (1979), B-3386 (2010)		
History, condition, and sources  In 1979 (B-873) John Carlich the Tillamook County Surveyor set a 2" iron pipe with a 3" brass cap in 10" tile and concrete stamped "N 1/16 S12 S7 RS 287 1979" no bearing trees were established. In 1979 (Rewitness Card #368) the Tillamook County Surveyor's office wrote up the corner in the Rewitness card files. In 2025 (Field Bk. MR 18 Pg. 7-8) the Tillamook County Surveyor's office found a 3" Tillamook County brass cap in tile and concrete stamped as shown hereon. Found accessories are listed below.  Found: (Rewitness Card #368: 86" hat section post West 1.5'), at location. Found: (Rewitness Card #368: 1 1/4" iron pipe ±35' Northerly), (B-873: 1 1/4" iron pipe N05°53'12"E 35.30'), at location Found: (B-873: remains of 80" dia. spruce GLO line tree S00°04'17" 5.93) at location large badly decade stump.		
New accessories set:  The corner was tied conventionally using GPS established control in Oregon North Zone NAD 83/91 grid coordinates in US survey feet. Coordinates are provided here in WGS 84 Latitude and Longitude.  Latitude: 45°24'57.51397" Longitude: -123°50'42.01670"  40" dia. spruce N88°W 48.3' scribed "T2SR10WS12N1/16BT" with yellow metal location tag.  15" dia. alder S89°E 16.55' scribed "XBT" with yellow metal location tag.  Nail with washer between the scribed B and the T on all new bearing trees		Pictures of Found Monuments:  
Location: ±100' South of the intersection of Tillamook River Rd. and Ekloff Rd. up on a steep hillside.		
Tillamook County Surveyor office: 1510 3 <sup>rd</sup> Street Suite C, Tillamook, OR. 97141  Party Chief: Travis Porter, Tillamook County Survey Technician III  Witnesses: Michael Rice P.L.S. 86926, Tillamook County Surveyor Kael Poklikuha, Tillamook County Survey Technician II  Notes: Digital images taken of monument and accessories.		SURVEYOR'S SEAL  REGISTERED PROFESSIONAL LAND SURVEYOR   OREGON DECEMBER 11, 2012 MICHAEL R. RICE 86926 RENEWAL 12-31-2026

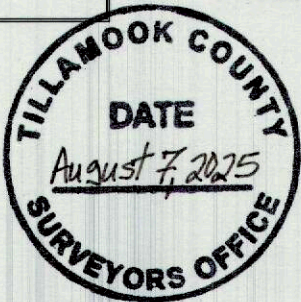

BOOK 8 227