



OREGON PUBLIC LAND CORNER REPORT / RESTORATION REPORT
Tillamook County Surveyor's Office

BOOK 8 247

SECTION: 16, 17, 20, 21	TOWNSHIP: 1 South	RANGE: 10 West
COUNTY: Tillamook	DATE: 4/8/2026	
CORNER DESIGNATION: Section corner common to sections 16, 17, 20 and 21, Township 1 South, Range 10 West, Willamette Meridian.	(Please check one)	
	X	Condition Report Only
		Restoration
		Rewitness
		Unrecorded
		Reset at surface
		Referenced Out
Previous Rewitnesses, Restorations and Surveys, etc... BLM field note volume: OR-R0053 Page 0201.00 (1857), A-876 (1958), Rewitness Card #304 (1976), P-272 (2004), B-3181 (2007), B-3505 (2021)		
History, condition, and sources 1857 (BLM Field notes) a post was set for the section corner, and 4 bearing trees were established. 1958 (A-876) a 5" post was set for the section corner. 1976 (Rewitness Card #304) a 3" brass cap stamped "SEC. COR. 17 16 20 21 T1S R10W" was found at position of the section corner and concrete was added around the monument with 1 new accessory added to the corner. In 2008 (B-3181) a 3" brass cap was found in concrete, and 4 new bearing trees were added. In 2026 Tillamook County Surveyor's office found a 3" brass cap in concrete stamped as shown hereon. Found accessories are listed below. Found: 34" dia. stump S83°E 29' badly decayed. (BLM field notes 18" dia. hemlock S83°E 44 links), (Rewitness card #304 40" dia. stump with CZ aluminum nail with scribing visible S83°E 29.3'), (B-3181 40" dia. hemlock stump S83°E 29.3') Found: badly rotted 4x4 white post lying next to monument. (Rewitness Card #304 4"x4"x48" post North 2.0'), (B-3181 4"x4" post East 0.7') Found: 25" dia. rotted stump with nail N25°W 82' (Rewitness Card #304 30" dia. hemlock stump N25°W 82.10 CZ BT), (B-3181 30" dia. hemlock stump with aluminum nail and rotted face N25°W 82.10') Found: 50" dia. hemlock stump with a tree growing off stump on side facing monument N54°E 39.0' (Rewitness Card #304 50" dia. stump N54°E 39.20' CZ BT), (B-3181 50" dia. hemlock stump with rotted face N54°E 39.20') Found: light hat section post North 1.50' (B-3181 light hat section post North 1.50') Found: 10" dia. 30' tall snag with scribing and nail with washer visible N84°W 33.48' (B-3181 10" dia. hemlock N84°W 33.48' with scribing and nail with washer stamped "LS 2507") Found: 29" dia. hemlock no tag with healed scar N08°E 20.13' (20" dia. spruce N08°E 20.63' with scribing and nail with washer stamped "LS 2507") Found: 20" dia. hemlock with healed scar and a yellow metal location tag S66°W 5.6' (B-3181 14 dia. hemlock S66°W 5.73' with scribing and nail with washer stamped "LS 2507") Found: windfall with yellow metal location tag and visible scribing with nail and washer showing S36°E (B-3181 13" dia. hemlock with scribing and nail with washer stamped "LS 2507") Found: 29" dia. spruce N56°W 70.8' with healed scar and yellow metal location tag (2010 unrecorded corner report Tillamook County Surveyor's office 22" dia. spruce N56°W 70.8" with scribing and nail with washer stamped "TILL. CO. SURVEYOR" between the B and T and with a yellow metal location tag) Found: 12 dia. fir S60°E 38.2' with healed scar and yellow metal location tag (2010 unrecorded corner report Tillamook County Surveyor's office 10" dia. fir S60°E 38.2' with scribing and nail with washer stamped "TILL. CO. SURVEYOR" between the B and T and with a yellow metal location tag) *For notes on corner see Field BK. MR 19 PG. 3-8 Tillamook County Surveyor's office.		
New accessories set: The Monument was tied conventionally using GPS control in Oregon North Zone NAD 83/91 grid coordinates in US Survey feet. Coordinates provided hereon are given in WGS 84 Latitude and Longitude. Latitude: 45°28'40.93076" Longitude: -123°55'37.66450"	Pictures of Found Monuments: 	
Location: ±300' East of Logging Road 700		
Tillamook County Surveyor office: 1510 3 rd Street Suite C, Tillamook, OR. 97141 Party Chief: Travis Porter, Tillamook County Survey Technician III Witnesses: Michael Rice PLS 86926, Tillamook County Surveyor Kael Poklikuha, Tillamook County Survey Technician II	SURVEYOR'S SEAL REGISTERED PROFESSIONAL LAND SURVEYOR  OREGON DECEMBER 11, 2012 MICHAEL R. RICE 86926 RENEWAL 12-31-2026	
Notes: Digital images taken of monument and accessories.		

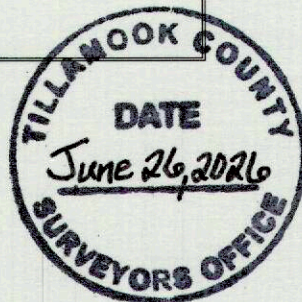

BOOK 8 247