
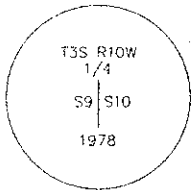


OREGON PUBLIC LAND CORNER REPORT / RESTORATION REPORT
Tillamook County Surveyor's Office

SECTION: East One-quarter corner Section 9	TOWNSHIP 3 South	RANGE 10 West	
COUNTY: Tillamook		DATE: 01-18-12	
CORNER DESIGNATION: The One-quarter Corner to common to Sections 9 and 10.		(Please check one)	
		<input type="checkbox"/>	Condition Report Only
		<input type="checkbox"/>	Restoration
		<input checked="" type="checkbox"/>	Rewitness
		<input type="checkbox"/>	Unrecorded
		<input type="checkbox"/>	Reset
Previous Rewitnesses, Restorations and Surveys, etc.: BLM Field Note Volume: OR-R0272, Page 141 1882; Tillamook County Surveyor GLO Book 3S10 Page 31; Rewitness Card #602, Rewitness Book 7 Page 114; Map B-833, Tillamook County Survey Records.			
Found Monument(s) and Accessories (Condition & Source): Found 3" diameter BLM brass cap upright and in good condition and encased in a 10" diameter concrete cylinder. The monument is stamped as shown hereon. Found hat section post North 1.4', the record position from Rewitness Book 7, Page 114. Found at record position a 16" Hemlock stump, 4' tall with a metal Tillamook County Surveyors bearing tree tag and with scribing visible (was a 14" Hemlock tree N. 77° E. 14.09' scribed "1/4S10BTCS". See Rewitness Book 7, Page 114). Found at record position a 21" Hemlock stump, 5' tall with a metal Tillamook County Surveyors bearing tree tag and with scribing visible (was a 19" Hemlock tree S. 50° W. 18.32' scribed "1/4S9BTCS". See Rewitness Book 7, Page 114). Found at record position a 22" Hemlock stump, 6' tall with a metal bearing tree tag and a healed face (was a 20" Hemlock tree with a healed blaze N. 25° W. 9.31' to a finish nail with a brass washer in a small blaze. See Rewitness Book 7, Page 114). Found at record position a rotten uproot with scribing visible (was a found rotten uproot scribing 1/4S BT visible. The face is located approximately 2' Westerly of the new NE Bearing Tree. See Rewitness Book 7, Page 114). Found a rotten tree lying on the ground (was an 11" Hemlock with a healed blaze S.42° E. 13.96' to a finish nail with a brass washer in a small blaze). Found a steel fence post lying down on the ground.			
The geodetic position for the found monument was obtained by GPS observations using dual frequency receivers with L1 and L2 phase processing. Latitude = 45° 19' 30.76332" N Longitude = 123° 54' 15.25171" W			
Monument Set (Procedures and Description): Not Applicable.		Sketch of Found Monument:	
			
Other new accessories set: No other accessories were set.			
New Bearing Trees: There are no standing trees large enough in the area to scribe as new bearing trees.			
Location & Comments: This corner is located approximately 100' Northerly of a small creek. The area has been recently replanted.			
Firm / Agency Address: TILLAMOOK COUNTY SURVEYOR'S OFFICE 201 Laurel Avenue Tillamook, Oregon 97141		SURVEYOR'S SEAL	
Party Chief: Joe Jensen, PLS 60067, Survey Supervisor, Deputy County Surveyor.		<div style="border: 1px solid black; padding: 5px; width: fit-content; margin: 0 auto;"> REGISTERED PROFESSIONAL LAND SURVEYOR </div>	
Notes:			
Witness: Danny R. McNutt, PLS 49230, Tillamook County Surveyor Michael R. Rice, LSI 16723, Survey Technician		<div style="border: 1px solid black; padding: 5px; width: fit-content; margin: 0 auto;"> OREGON JANUARY 10, 2008 JOSEPH V. JENSEN 60067 </div>	
		RENEWAL DATE: 06-30-2013	

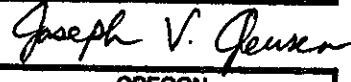

BOOK 8 007