

(5)

CHAINS

SURVEY FOR THE OREGON STATE BOARD OF FORESTRY

February 20, 1951

Var. 22° E.

Restoration of the corner to sections 2, 3, 34, & 35, Townships 1 & 2 North, Range 7 West, W.M., Tillamook County, Oregon.

The point for corner determined by the remains of the original bearing trees:

A fir snag, 43 inches in diam., bears S 28° W, a distance of 23.1 feet. The scribe marks: 1N R7W S3 B1 are visible.

An uprooted hemlock stub, 5 inches in diam., in the NW quadrant. The scribe marks B1 are plainly visible. The stump hole could not be determined.

No evidence remains of the other B1's. nor could the corner stone be found.

At the point for corner:

Set a 1½ inch iron pipe, 3 feet long with an Oregon State Board of Forestry bronze cap stamped: T2N R7W S34 S35 S3 S2 T1N 1951 199.

from which:

A fir snag, 21 inches in diam., bears S 46° W, a distance of 26.2 feet, scribed: T1N R7W S3 B1 199.


A hemlock snag, 30 inches in diam., bears N 51° W, a distance of 51.2 feet, scribed: T2N R7W S34 B1 199.

A fir snag, 31 inches in diam., bears N 83° E, a distance of 29.4 feet, scribed: T2N R7W S35 B1 199.

Placed a metal location poster on this B1 marked: Sec. 35 T2N R7W Sec Cor 28.5 ft. S 83° E.

Placed a mound of stone 1 ft. high & 1½ ft. base around the corner.

The above work done by Don Davis, Transitman; Adolf Berglund and Richard Morris, Chainmen; under my direction.

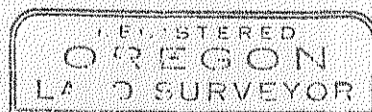

Lyle E. Beyers
Forest Engineer

