

(23)

CHAINS

SURVEY FOR THE OREGON STATE BOARD OF FORESTRY

January 10, 1951

Restoration of the $\frac{1}{4}$ section corner to sections 16 & 21, Township 2 North, Range 6 West, W.M., Tillamook & Washington Counties, Oregon.

The point for corner determined by the remains of the original bearing trees:

A fir stump, 31 inches in diam., bears S 24° E, a distance of 35.0 ft. (53 lks). Scribe marks: $\frac{1}{4}$ S exposed. (The original notes call this bearing S 36° E, believe this to be an error in reading the compass).

A hemlock stump, 36 inches in diam., bears N 15° E, a distance of 17.8 ft. (27 lks). Scribe marks: $\frac{1}{4}$ B¹ exposed.

At the corner point:

Set a 1 $\frac{1}{2}$ inch iron pipe, 3 feet long, filled with charcoal, with an Oregon State Board of Forestry bronze cap stamped: $\frac{1}{4}$ S 16 S21 1951 199.


From which:

A fir stump, 23 inches in diam., bears S 84° W, a distance of 19.9 feet, scribed: $\frac{1}{4}$ S 21 199 B¹.

A noble fir spar pole, 46 inches in diam., bears S 70° 30' E, a distance of 55 feet.

Placed a metal location poster on a 46 inch hemlock snag and marked it Sec. 16 T2N R6W $\frac{1}{4}$ Cor. 33.0 ft. S 24° E.

The above work done by Don Davis, Transitman; Richard Morris and Bill Kleeman, Chainmen; and John McWade, Flagman; under my direction.

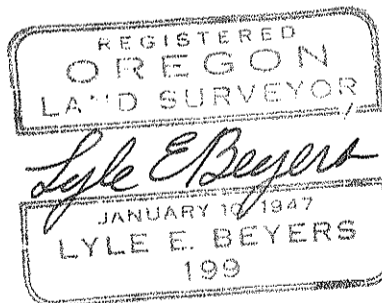

Lyle E. Beyers
Forest Engineer