

CHAINS

RESTORED CORNER FOR OREGON STATE BOARD OF FORESTRY

Corner common to sections 6 and 7, T. 1 N., R. 6 W., W. M.,
Tillamook County, Oregon.

ORIGINAL

Stone, 15" x 12" x 6"; now missing, from which a:

48" Hemlock bears S45W 9 lks; now 40" stub, scribe marks
R T S exposed.

RESTORED CORNER AND BEARING TREES



Set a 1½" x 36" galvanized iron pipe with 3" bronze cap marked
"OREGON STATE BOARD OF FORESTRY T1N R7W T1N R6W S6 S7 1949
199", 2½ ft. in ground, from which a:

38" Fir snag bears S31E 88.4 ft.; scribed T1N R6W S7 199 BT.
59" Fir stump bears N45°30'E 64.9 ft.; scribed T1N R6W
S6 199 BT.

Placed an Oregon State Board of Forestry metal location poster
on 40" Hemlock stub BT and marked it: Sec 6&7 T1N R6W Sec
Cor 6.0 ft N45E.

Dated June 7, 1951.

This corner was restored by Don D. Davis
Don D. Davis Asst. Forest Engineer
under my direction.

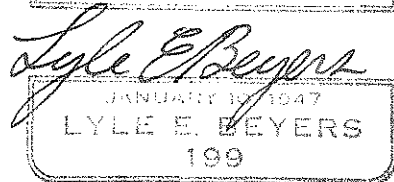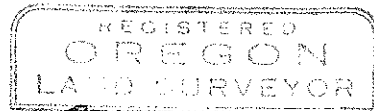

Present and witnessed by Richard A. Morris
Richard A. Morris Compassman

Present and witnessed by Douglas Stafford Chainman