

CHAINS

RESTORED FOR OREGON STATE BOARD OF FORESTRY

Corner common to sections 16, 17, 20, and 21, Township 1 South,  
Range 7 West, W.M., Tillamook County, Oregon.

ORIGINAL

Post, now missing, from which a:

- 7" Hemlock bears S80E 33 lks; now 15" stub, 4 ft. high, BT exposed.
- 72" Fir bears N24E 180 lks; now 80" snag, scribe marks S S BT exposed.
- 27" Hemlock bears N62°30'W 121 lks; now 34" stub, 10' high, N67°30'W, scribe marks T1S R7W S17 exposed.
- 20" Hemlock bears S37W 126 lks; now 24" down snag, scribe marks BT exposed.

RESTORED CORNER AND BEARING TREES


Set 1½" x 36" galvanized iron pipe with 3" bronze cap marked  
"OREGON STATE BOARD OF FORESTRY T1S R7W S17 S16 S20 S21  
1952 2311, 2½' in ground, from which a:

- 72" Fir snag bears N22W 33.6'; scribed T1S R7W S17 BT.
  - 43" Fir snag bears S83°30'W 12.3'; scribed T1S R7W S20 BT.
  - 43" Fir snag bears S30E 54.2'; scribed T1S R7W S21 BT RE 2311.
- Nothing available to scribe in NE quadrant.

Placed an Oregon State Board of Forestry metal location poster on 43" Fir snag BT and marked it: Sec 20 T1S R7W Sec Cor 12.3 ft. N83°30'E.

Dated April 15, 1952.

This corner was restored by Don D. Davis  
under my direction. Don D. Davis Assistant Forest Engineer

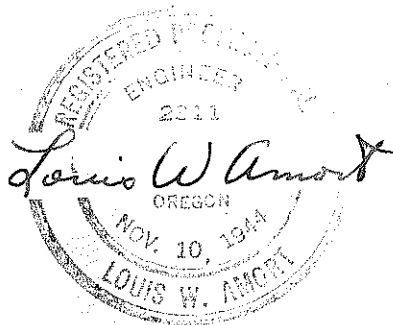

Present and witnessed by Richard A. Morris  
Richard A. Morris Compassman

Present and witnessed by Robert A. Young  
Robert A. Young Chainman