

CHAINS

RESTORED FOR OREGON STATE BOARD OF FORESTRY

Corner common to sections 26, 27, 34, and 35, Township 1 South,
Range 7 West, W.M., Tillamook County, Oregon.

ORIGINAL

Post, now missing, from which a:

- 12" Hemlock bears S78°30'E 47 lks; now 20" stub 5' high,
exposed scribe marks BT.
- 12" Hemlock bears N25°30'E 16 lks; now 20" down tree.
- 16" Hemlock bears N69W 52 lks; now 22" stub 6' high,
exposed scribe marks TLS R7W S27.
- 40" Hemlock bears S39W 59 lks; now missing.

RESTORED CORNER AND BEARING TREES


Set 1 1/8" x 36" galvanized iron pipe with 3" bronze cap marked
"OREGON STATE BOARD OF FORESTRY TLS R7W S27 S26 S34 S35 1952
2311," 2 1/2" in ground, from which a:

- 42" Fir snag bears S30E 61.4'; scribed TLS R7W S35 BT.
- 4" Alder bears S40W 12.0'; scribed TLS R7W S34 BT.
- 50" Fir snag bears N74W 32.0'; scribed TLS R7W S27 BT
RE 2311.
- 66" Fir snag bears N10E 39.4'; scribed TLS R7W S26 BT.

Placed an Oregon State Board of Forestry metal location poster
on 66" Fir snag BT and marked it: TLS R7W Sec Cor 39.4 Ft.
SLOW.

Dated May 8, 1952.

This corner was restored by Don D. Davis,
under my direction. Don D. Davis Assistant Forest Engineer

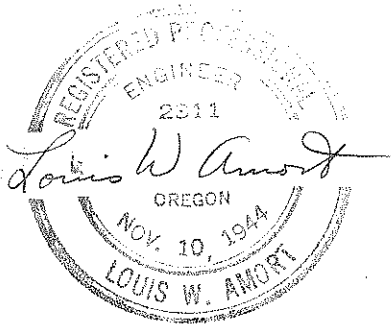

Present and witnessed by Richard Morris
Richard A. Morris, Compassman

Present and witnessed by Robert A. Young
Robert A. Young, Chairman