

CHAINS

RESTORED CORNER FOR OREGON STATE BOARD OF FORESTRY

One quarter corner common to sections 31 and 36, Township 2 North, Ranges 7 & 8 West, W.M., Tillamook County, Oregon.

ORIGINAL

15" x 10" x 7" basalt stone, now missing, from which a:

- 36" Hemlock bears N55W 10 lks; now missing.
- 48" Fir bears N58E 27 lks; now 30" Fir snag, scribe marks 1/4 S exposed.

RESTORED BEARING TREES

AS WITNESS CORNER

Set 1 1/2" x 36" galvanized iron pipe with 3" bronze cap marked "OREGON STATE BOARD OF FORESTRY WC 1/4 S36 S31 5 Ft. S 1952 2311," 2 1/2" in ground, 5.0' north of corner point. Raised mound of stone around pipe, from which a:


- 45" Fir snag bears N25E 22.4"; scribed WC 1/4 S31 BT RE 2311.
- 27" Fir snag 20' high bears S21W 27.3"; scribed WC 1/4 S36 BT.

(Corner point falls under 4 foot Fir log lying NNW & SSE.)

Placed an Oregon State Board of Forestry metal location poster on 42" Fir snag and marked it: Sec 36 T2N R8W WC 1/4 Cor 12.7 Ft. N31E.

Dated June 7, 1952.

This corner was restored by Don D. Davis under my direction. Don D. Davis Assistant Forest Engineer

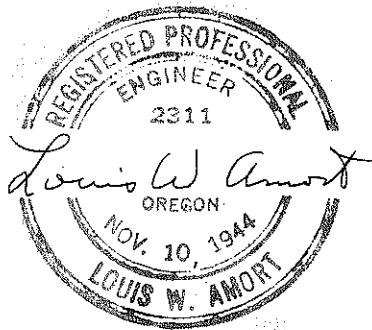

Present and witnessed by Richard A. Morris Richard A. Morris Compassman

Present and witnessed by Robert A. Young Robert A. Young Chairman