


CHAINS

Restoration of the $\frac{1}{4}$ corner between Section 36, T 2 S, R 11 W, W.M. and Section 31, T 2 S, R 10 W, W.M.

I set a $1\frac{1}{2}$ " x $2\frac{1}{2}$ " galvanized pipe with a lead plug 2" above the ground, exactly 16.5 feet N 40 E of a 24" Spruce snag with blazes and a face with scribe marks plainly visible (this being an original BT). Other evidence of the corner is a 32" Hemlock uproot with a rotted face (no scribe marks visible) N 11 E 30 links. Because of logging scheduled in the area, the corner was rewitnessed to the following three trees. Var. 22 E

- A Hemlock 10" bearing S $16\frac{1}{2}$ E 13.7 feet marked " BT $\frac{1}{4}$ S 31 # 376"
 - A Hemlock 18" Bearing S 25 W 19.4 feet marked " BT $\frac{1}{4}$ S 36 # 376"
 - A Hemlock 13" bearing N $36\frac{1}{4}$ W 22.9 feet marked " BT $\frac{1}{4}$ S 36 # 376"
- This tree has a Yellow Tag on it.

The top of the lead plug is marked as follows:

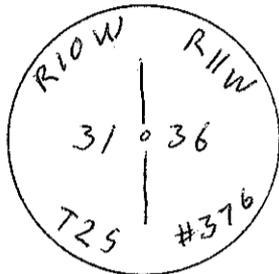

February 9, 1961

In the presence of:

Roswell K. Miller
Willis D. Malone

Charles G. Collard

Charles G. Collard
Registered Land Surveyor
Oregon # 376

Restoration of the Section corner of Sections 22, 23, 26, 27, T 2S, R 10 W, W.M.

I set a $1\frac{1}{2}$ " x $2\frac{1}{2}$ " galvanized pipe with a lead plug 2" above the ground, the exact bearings and distances from the following original BT's.

- Old Hemlock stump, 30", bearing N 54 W 39 links, rotten with no face or scribing visible
- Old Hemlock stump, 25", bearing N 70 E 14 links, scribing still visible
- Old Hemlock stump, 36", bearing S 44 E 11 links, scribing still visible
- Old Hemlock stump, 24", bearing S 80 W 46 links, a face but no scrib marks visible

The corner was then rewitnessed as follows: Var. 22 E.

- A Hemlock 10" bears N $36\frac{1}{2}$ E 10.9 feet with a Yellow Tag
Tree marked "BT S 23 # 376"
- A Hemlock 9" bears S $78\frac{1}{2}$ W 4.9 feet, marked " BT S 27 #376"
- A Hemlock 8" bears N 20 W 17.9 feet, marked " BT S 22 #376"
- A fourth tree was not available within a reasonable distance.

October 3, 1960

In the presence of:

Roswell K. Miller
Willis D. Malone

Charles G. Collard

Charles G. Collard
Registered Land Surveyor
Oregon # 376

