

CHAINS

SURVEY FOR THE OREGON STATE BOARD OF FORESTRY

Reestablishment of the monument for the corner common to sections 1 and 12, T. 1 N., R. 7 W., W.M., Tillamook County, Oregon.

The point for corner determined from the corner common to sections 6 and 7, T1N R6W, a 1½" x 36" galvanized iron pipe with 3" bronze cap marked "OREGON STATE BOARD OF FORESTRY T1N R7W T1N R6W S1 S6 S7 1949 199" from which a:

- 48" Hemlock bears S45W 9 lks; now 40" stub, scribe marks R T S exposed.
- 38" Fir snag bears S31E 88.4 ft; scribed T1N R6W S7 199 BT.
- 59" Fir stump bears N45°30'E 64.9 ft; scribed T1N R6W S6 199 BT.

At a point 56.8 ft. south of the corner common to secs 6 and 7, T1N R6W


Set a 1½" x 36" galvanized iron pipe with 3" bronze cap marked "OREGON STATE BOARD OF FORESTRY T1N R7W R6W S1 S7 S12 1949 199, 2½ ft. in ground from which a:

- 20" Hemlock stub bears S57W 12.5 ft; no evidence of marks found.
- 60" Fir snag bears N68W 35.5 ft; scribed T1N R7W S1 BT 199.

Placed an Oregon State Board of Forestry metal location poster on a 38" Hemlock stub and marked it: Sec 1 T1N R7W Sec Cor 50.3 ft. S06E.

Dated June 7, 1951.

This corner was reestablished by Don D. Davis,
Don D. Davis Asst. Forest Engineer
under my direction.

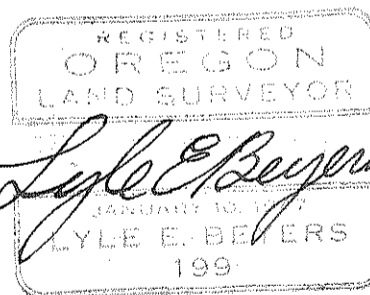

Present and witnessed by Richard A. Morris
Richard A. Morris Compassman

Present and witnessed by Douglas Stafford Chainman