

CHAINS

RESTORED CORNER FOR OREGON STATE BOARD OF FORESTRY

Closing corner common to sections 5 and 6 T1S R7W, WM., Tillamook County, Oregon.

ORIGINAL

Post, now missing, from which a:

- 26" Hemlock bears N60E 20 lks; now 30" snag, no face or scribe marks exposed.
- 22" Hemlock bears S17E 52 lks, now 24" stub, scribe marks T1S R7W S5 exposed.
- 5" Hemlock bears S8W 7 lks, now missing.

RESTORED CORNER AND BEARING TREES

Set 1 1/2" x 36" galvanized iron pipe with 3" bronze cap marked "OREGON STATE BOARD OF FORESTRY T1N R7W S31 S6 S5 T1S R7W CC 1952 2311," 26" in ground, from which a:


- 60" Fir stump bears S40W 22.3'; scribed T1S R7W S6 BT.
- 58" Fir snag bears S66E 14.5'; scribed T1S R7W S5 BT RE 2311.

Placed an Oregon State Board of Forestry metal location poster on 58" Fir snag BT and marked it: Sec 5 T1S R7W Closing Cor 14.5' N66W.

Dated August 15, 1952.

This corner was restored by my direction.

Richard A. Morris, under  
Richard A. Morris - Compassman

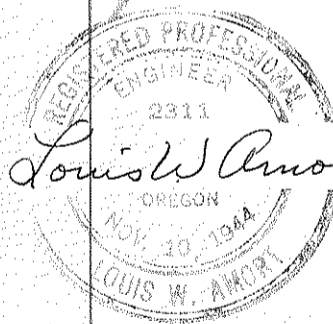

*Louis W. Amort* was present on corner  
See opposite page

Present and witnessed by

Robert A. Young  
Robert A. Young - Chairman

179

CHAINS

RESTORED CORNER FOR OREGON STATE BOARD OF FORESTRY

Closing corner common to sections 5 and 6, Township 1 South  
Range 7 West, WM., Tillamook County, Oregon.

ORIGINAL

Post; now missing, from which a:

26" Hemlock bears N60E 20 lks; now 15" snag, scribe marks  
T1N R7W S32 BT exposed.

22" Hemlock bears S17E 52 lks; now missing.

5" Hemlock bears S8W 7 lks; now 6" down stub out of  
place, scribe marks T1S R7W S BT exposed.

RESTORED CORNER AND WITNESSED CORNER POINT

Set 1½"x36" galvanized iron pipe with 3" bronze cap marked  
"OREGON STATE BOARD OF FORESTRY T1N R7W S32 S6 S5 CC T1S R7W  
1952 2311," 2½' in ground. Raised mound of stone around  
corner pipe, from which a:

50" Fir stump bears S67E 79.0'; scribed T1S R7W S5 CC BT  
RE 2311.

3" Hemlock bears S24W 29.6'; scribed S6 BT.

Placed an Oregon State Board of Forestry metal location poster  
on original BT now 15" Hemlock snag and marked it: Sec 32 T1N  
R7W Closing Cor 13.2 Ft. S60W.

Dated December 2, 1952

This corner was restored by  
under my direction.

*Don D. Davis*  
Don D. Davis Assistant Forest Engineer



Present and witnessed by Gerald M. Schwalen, Chairman.