

CHAINS

RESTORED CORNER FOR OREGON STATE BOARD OF FORESTRY

Section corner common to sections 9, 10, 15, and 16, T2N R7W, WM., Tillamook County, Oregon.

ORIGINAL

20"x12"x8" basalt stone with mound of stone alongside; now missing, from which a:

62" Fir bears S13E 31 lks; now 50" snag, scribe marks T2 exposed on burnt face.

(Also found a 41" Hemlock snag S03°17'W 8.73 chains with scribe marks R7W S16 exposed on old face. This BT does not conform with the call of the original field notes, nor does its position with regard to topography conform with that of the corner described in the original field notes.)

RESTORED CORNER AND WITNESSED CORNER POINT

Set 1½"x36" galvanized iron pipe with 3" bronze cap marked OREGON STATE BOARD OF FORESTRY T2N R7W S9 S10 S16 S15 1952 2311, 2½' in ground. Raised mound of stone around corner pipe, from which a:

24" Fir stub 18' high bears S56W 10.0'; scribed T2N R7W S16 BT.

72" Fir bears S85E 8.3'; scribed T2N R7W S15 BT.


54" Fir stub 12' high bears N35W 29.1'; scribed T2N R7W S9 BT RE 2311.

84" Fir bears N07E 14.0'; scribed T2N R7W S10 BT.

Placed an Oregon State Board of Forestry metal location poster on 84" Fir BT and marked it: Sec 10 T2N R7W Sec Cor 14.0' S07W.

Dated December 16, 1952

This corner was restored by Don D. Davis under my direction. Don D. Davis Assistant Forest Engineer

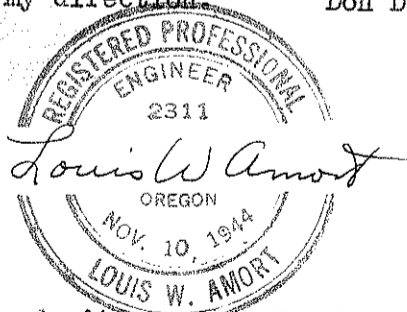

Present and witnessed by Gerald M. Schwalen, Chainman.