

NE Section Corner

Found 1½" x 48" iron pipe for the Section corner to 15, 16, 21 22 from which

A spruce stump 38 inches in diameter bears N 29½ E 19.0 feet

A hemlock stump 46 inches in diameter bears S 51 E 14.2 feet

No BTs were in Sections 16 or 21 due to lack of material

At the corner point set in the ground a 2" x 30" iron post with brass cap marked

T 5 S R 10 W

16 | 15
21 | 22

1968

ORLS 650

Deposited iron pipe alongside iron post

NE corner of the West 35 acres of the NW¼, NE¼

Found a 1" iron rod for the corner from which

A spruce 46 inches in diameter bears N 25½ W 85.5 feet

A spruce 39 inches in diameter bears S 38 W 1.0 feet

Because the iron rod was lodged in the roots of a tree and could not be removed, set in the ground 5.29 feet west on Section line a 2" x 30" iron post with brass cap marked

T 5 S R 10 W


NE Cor

16
21

W. C.

1968

ORLS 650

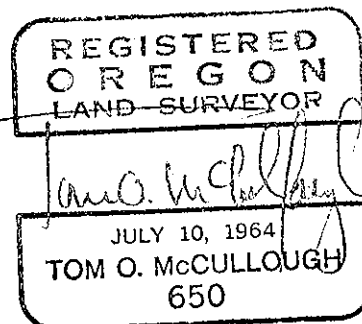

SE corner of the West 35 acres of the NW¼, NE¼

Found a 1½" x 24" iron pipe for the corner from which

A hemlock 24 inches in diameter bears S 80½ E 17.88 feet

A hemlock 32 inches in diameter bears N 44 E 18.2 feet (slope)

At the corner point set in the ground a 2" x 30" iron post with brass cap marked