

County Surveyor's Record, Tillamook County, Oregon

CHAINS

T3S R10W

16 | 15
 21 | 22

EVALUATION AND RESTORATION OF LAND SECTION CORNERS

Section Corner common to Sections 15-16-21-22, W.M.
 Tillamook County, Oregon

ORIGINAL:

Set post, 4 ft. long, 6 ins. diam., 12 ins. in ground, for cor. to secs. 15-16-21-22, mkd. T3SS15 on N.E., R10WS22 on S.E., S21 on S.W., S16 on N.W., with 3 notches on E. and S. edges; from which

Vine Maple, 6 ins. diam., bears S13°W, 15 lks. dist., mkd. T3SR10WS21BT.

Hemlock, 10 ins. diam., bears S70°E., 14 lks. dist., mkd. T3SR10WS22BT.

Hemlock, 12 ins. diam., bears N82°E., 19 lks. dist., mkd. T3SR10WS15BT.

Hemlock, 10 ins. diam., bears N64°W., 16 lks. dist., mkd. T3SR10WS16BT.

William P. Wright, Deputy Surveyor
 1882

FOUND:

3/4" pipe, 36" above the ground.

1 1/4" Hem. stub in decayed condition 6' high, N.82°E., 19 lks. (orig.) with scribe mks. "B1" of which is half the BT.

12" decayed Hem. stump 1 ft. above the ground. A rotted slab lies at its base with visible mks. "S16". This stump is N64°W., 16 lks. as in orig. notes.

36" Hem., N67°W., 12.4 ft. with a yellow location tin posted by M. Whitmore, 7-18-55.

RESTORED: I mark 3 new BT's:

36" Hem., N67°W., 12.4 ft. mkd. T3S, R10WS16BT

3 1/2" Hem., N32°E., 4.1 ft. mkd. XBT, 12" above ground

4 1/2" Hem., S63°W., 10.2 ft. mkd. XBT, 24" above the ground. There is no suitable witness tree available in Section 22.

DATED: 2-9-67

RESTORED BY: Leoard Whitmore, Tillamook County Deputy Surveyor

WITNESSED BY: Glen Horner

County Surveyor's Record, Tillamook County, Oregon

CHAINS


5680-2

★ U. S. GOVERNMENT PRINTING OFFICE

(Rectangular)

1. T. 35 R. 10W No. 113 Con. Sec. Mer. Will. State OR N. F. SIUSLAW Dist. HeBo

2. Corner Status

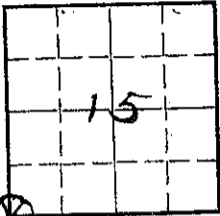

3. Original Description _____ Vol. _____ Page _____ Where Recorded _____

4. Description of Corners:

5. Investigation Notes:

FOUND 3/4" PIPE 36" ABOVE GROUND.
 FOUND 14" HEM. STUB IN DECAYED CONDITION 6' HIGH,
 N. 82° E., 19 LKS. (ORIG) WITH SCRIBE MKS. "B 1" OF WHICH
 IS HALF THE BT.
 FOUND 12" DECAYED HEM. STUMP 1 FT. ABOVE GROUND.
 A ROTTED SLAB LIES AT ITS BASE WITH VISIBLE MKS.
 "S 16". THIS STUMP IS N. 64° W., 16 LKS. AS IN ORIG. NOTES.
 FOUND 36" HEM., N. 67° W., 12 1/4 FT. WITH A YELLOW LOCATION
 TIN POSTED BY M. WHITMORE 7-18-55.

7. Photo Identification

Photo No. _____
 Ident. By: _____

8. Plane Coordinate Position Data

State _____ Zone _____
 X _____
 Y _____
 Estab. By _____
 Field Book No. BOOK 3
 Where Filed _____

9. Evaluation

11. Accessories I MARK 3 NEW BT'S:

36" HEM., N. 67° W., 12 1/4 FT. MKD. T 35 R 10 W S 16 C S BT
 3 1/2" HEM., N. 32° E., 4 1/2 FT. MKD. ~~XXXXXXXXXX~~ X BT 12" ABOVE GROUND.
 4 1/2" HEM., S. 63° W., 10 1/2 FT MKD. X BT 24" ABOVE GROUND

THERE IS NO SUITABLE WITNESS TREE AVAILABLE IN SEC. 22
 WITNESS: GLEN HORNER Leonard Whitmore, Tillamook Co. Sup. Surveyor

Field Book _____ Page _____

12. Set By _____ Title _____
 License _____ Agency _____ Date _____

13. Recorded By _____ Volume _____ Page _____
 (Agency) _____
 (Date) _____ (City) _____ (County) _____ (State) _____

14. Remarks:

2-9-67

BOOK 3

BOOK 3