

CERTIFIED RECORD OF LAND CORNER MONUMENTATION


**History of original corner establishment:**

Corner set by Henry Meldrum June 4, 1879

M. Whitmore found corner on 12/4/58 and scribed 2 new BTs.

Meldrum set a fir post from which

- A 36" cedar brs. S57W 13 lks
- A 4" alder brs. S20E 28 lks
- A 4" alder brs. N34W 96 lks
- A 20" fir brs. N59E 126 lks

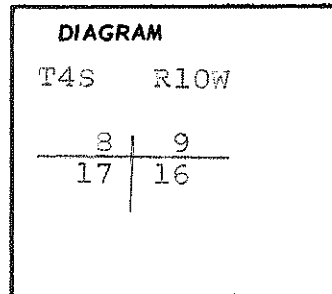

**Description of corner evidence found:**

Found 1"x48" iron pipe from which

- 26" snag brs. N59E 83 ft. (see)
- (found rotted slab on ground with scribing T4S barely visible - nailed slab on snag)
- 42" fir brs S33½E 31 ft (M. Whitmore, 12/4/58) *(See Book 2 P. 400)*
- 36" cedar snag brs. S57W 8.5 ft - no scribing visible, but has axe blaze (see)
- 12" spruce brs. N21W 40 ft (M. Whitmore, 12/4/58)

**Description of monument and accessories established to perpetuate the original location of this corner**


Set 2"x30" iron pipe with brass cap mkd

T4S R10W  
 8 | 9  
 17 | 16  
 1970  
 650 from which

- 14" alder brs. N30E 19.2 ft
- scribed T4S R10W S9 BT
- 14" alder brs. S17W 16.6 ft
- scribed T4S R10W S17 BT 650

Drove steel fence post 5 ft south of corner with Forest Service and attention sign facing west and a fence post 5 feet west of corner with Forest Service boundary sign facing south. Placed BT signs and painted red band on all BTs. Drove 1" pipe alongside monument. why?

Office of County Surveyor County of TILLAMOOK  
 State of OREGON, I hereby certify that the within instrument was filed in this office  
 for record on the 8<sup>th</sup> day of July, 1970, at        o'clock        m., (signed)  
John Condit by County Surveyor  
 (COUNTY OFFICIAL) (DEPUTY)

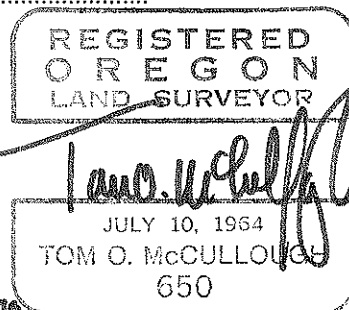

BOOK 5

4/6/70