

County Surveyor's Record, Tillamook County, Oregon

CHAINS

RESTORED CORNER FOR STATE OF OREGON-DEPARTMENT OF FORESTRY

Section corner common to Sections 1, 2, 11 and 12, T.3N,
R.10W, W.M., Tillamook County, Oregon.

ORIGINAL

Post (now missing) from which a:

- 6" Hemlock bears N31°W 13 lks.; now missing.
- 6" Hemlock bears S10°W 24 lks.; now missing.
- 6" Hemlock bears S45°E 45 lks.; now missing.
- 90" Spruce bears N20°E 27 lks.; now 86" snag, no scribes remaining.
- Original Lineblaze bears North 206 ft.; on 72" Spruce snag.
- Original Lineblaze bears N87°28'W. 350 ft.; on 50" Fir stump.
- Lineblaze bears East 64 ft.; on 60" Hemlock stump.
- Railroad Grade bears West 726 ft.; Course S10°E, as recorded in railroad description at county court house.

P

RESTORED

Var. 21½E

Set 1½" x 36" galvanized iron pipe with 3" bronze cap marked "OREGON STATE BOARD OF FORESTRY T3N R10W 1, 2, 11, 12, 1962 RS 401", 32 inches in ground, and from which a:

- 27" Hemlock bears N50°W 34.0 ft.; scribed T3N R10W S2BT RS401.
- 22" Spruce bears S65½°E 46.4 ft.; scribed T3N R10W S12 BT.
- 36" Spruce bears S2½°W 50.7 ft.; scribed T3N R10W S11 BT.
- 26" Spruce bears N62°E 74.1 ft.; scribed T3N R10W S1 BT.


Found ½" pipe West 201.6 ft.

Oregon State Forestry Department metal location poster on 27" Hem. BT.
Set 4" x 4" x 50" white painted Cedar post 1.0 ft. SE of corner pipe.

Dated March 27, 1963.

Restored by Billy E. Davis under my direction.
Billy E. Davis Transitman

Present and witnessed by A. Duncan
D. Fletcher

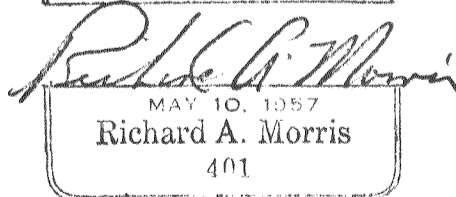

BOOK 5

BOOK 5