

UNITED STATES DEPARTMENT OF AGRICULTURE
FOREST SERVICE

SIUSLAW NATIONAL FOREST
P. O. Box 1148, Corvallis, OR 97330

REPLY TO: 7150

July 21, 1976

SUBJECT: Record of Corner Monumentation

TO: County Surveyor



Enclosed are Certified Record of Land Corner Monumentation forms for recording in your office.

Please fill in the applicable information and return a copy for our records.

Thank you.

Dwight L. Makinson

DWIGHT L. MAKINSON
Land Surveyor

Enclosure

FIND: T.4S. R.10W 1/4 S12
" " sec. cor 12, 13
" " 1/4 S 36, S31 (R9W)
T.4S. R.9W. CC S7, S18
" " sec. cor. 19, 20
" " sec. cor, S16, S17, S20, S21
" " 1/4 cor S20, S21
" " T4S R10W S19, S30, S29, S24
" " " " 1/4 cor S 25, S30
" " " " sec. cor S30, S31, S25, S36

DM 7/21/76

County Surveyor's Record, Tillamook County, Oregon

CHAINS

RESTORED CORNER FOR STATE OF OREGON-DEPARTMENT OF FORESTRY

Southeast one-sixteenth corner for Section 17, T3S, R8W, W.M., Tillamook County, Oregon.

ORIGINAL

OSBF Pipe and Cap, 1962 (missing in road construction) from which a:

22" Fir bears S15½°E 161.9 ft.; now 26" face grown over.

20" Fir bears N24°W 266.0 ft.; now 21" face grown over, yellow metal location poster on Southeast side.

RESTORED

Var. 21½° East

Set 1½" x 36" galvanized iron pipe with 3" bronze cap marked "OREGON STATE BOARD OF FORESTRY SE 1/16 S17 1976 RS707", 34 inches in ground, in cement and mound of rock and from which a:

21" Fir (Orig.) bears N24°W 266.0 ft. to face; scribed RS 707.


Moon Creek road bears West 12.0 ft. to centerline, course N2°W by S5°E.

Set 4" x 4" x 60" white painted Cedar post 2.0 ft. SW of corner pipe. Oregon State Forestry Department metal location poster on 4" Alder N82½°W 40.8 ft.

Dated June 29, 1976.

Restored by Keith D. Whitehead under my direction.
Keith D. Whitehead, Transitman

Present and witnessed by Michael Nordin
Barbara Fennessey

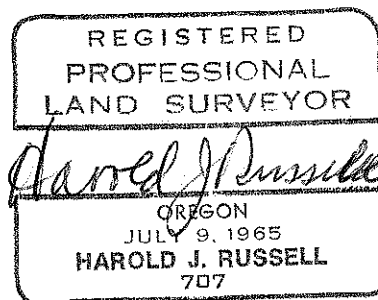

BOOK 5