

County Surveyor's Record, Tillamook County, Oregon

CHAINS

RESTORED CORNER FOR STATE OF OREGON--DEPARTMENT OF FORESTRY

Section corner common to Sections 4, 5, 8 and 9, T3N, R10W, W.M., Tillamook County, Oregon.

ORIGINAL

22" Hemlock corner tree (now 34" stump, exposed scribe on NE side with blades on NW, SW, SE, sides) from which a:

- 10" Hemlock bears N34°E 30 lks.; now 30" stump face grown over.
- 8" Hemlock bears S65°E 31 lks.; now 23" stump exposed scribes.
- 7" Hemlock bears S20°W 17 lks.; missing.
- 6" Hemlock bears N38°W 29 lks.; now 16" uproot, exposed scribes.

RESTORED

Var. 2 1/2°E

Set 1 1/2" x 12" galvanized iron pipe with 3" bronze cap marked "OREGON STATE BOARD OF FORESTRY T3N R10W S4 S5 S8 S9 1976 RS707", 12 inches in center of corner tree stump, and from which a:


- 5" Hemlock bears S43°W 12.5 ft. to face; scribed T3N R10W S8 BT.
- 7" Spruce bears N55°W 50.8 ft. to face; scribed T3N R10W S9 BT RS707.

Set 4" x 4" x 60" white painted Cedar post 1.8 ft. SW of corner pipe. Oregon State Forestry Department metal location poster on 34" Hemlock corner tree stump.

Dated June 29, 1976.

Restored by Keith Whitehead under my direction.
Keith Whitehead, Transitman

Present and witnessed by Mike Nordin

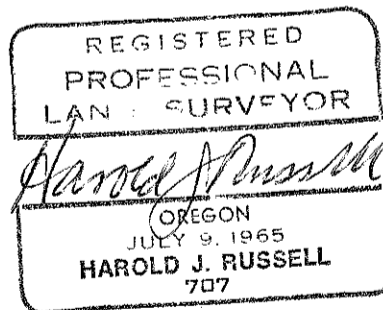

BOOK 5