

REWITNESSED CORNER FOR STATE OF OREGON - DEPARTMENT OF FORESTRY

Section corner common to Sections 1, 2, 11 and 12, T3N, R10W, W.M., Tillamook County, Oregon.

ORIGINAL by C. J. Handley, August, 25, 1873.

Post; missing.

- 6" Hemlock bears N31W 13 lks.; missing.
- 6" Hemlock bears S10W 24 lks.; missing.
- 6" Hemlock bears S45E 45 lks.; missing.
- 90" Spruce bears N20E 27 lks.; missing, torn out by road construction.

RESTORATION by Richard A. Morris LS401, March 27, 1963 (Book 5, page 275, Tillamook County Records).

- 1 1/2"x36" galvanized iron pipe with 3" bronze cap, 32" in ground; found in place, 36" in ground.
- 27" Hemlock bears N50W 34.0 ft.; now a 25"x7 ft. high badly rotted stump with portions of scribes T3NR10WS2BTRS401 visible.
- 22" Spruce bears S65 1/2E 46.4 ft.; missing, torn out by road construction.
- 36" Spruce bears S02 1/2W 50.7 ft.; now a 39"x6 ft. high badly rotted stump with portions of scribes visible.
- 26" Spruce bears N62E 74.1 ft.; now a 29"x3 ft. high badly rotted stump with portions of scribes visible.
- 4"x4"x50" white painted Cedar post 1.0 ft. SE of corner pipe.; in place.

REWITNESSED May 17, 1988

Var. 21 1/2 E

From the above pipe with marks "LS1998 1988" added, and from which a:

- 9" Spruce bears N51 1/2W 11.1 ft. to face; scribed T3NR10W S2BT.
- 9" Spruce bears N56E 48.6 ft. to face; scribed T3NR10WS1BT.
- 9" Spruce bears S56E 7.55 ft. to face; scribed T3NR10WS12BT.
- 12" Spruce bears S57W 30.0 ft. to face; scribed T3NR10WS11BT.
- Centerline Coal Creek road bears East 27.8 ft.; runs N43W by S33E.


Metal location poster on new BTs.

3/4" brass washer marked "LS1998" nailed to face of new BTs.

Present and witnessed by Clifford R. Foster and Joseph M. Hutton.

Rewitnessed by David B. Buchholz under my direction.

David B. Buchholz, LS2272

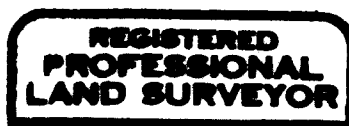

*Anthony J. Klosterman*

