


CERTIFIED RECORD OF LAND CORNER MONUMENTATION

History of original corner establishment:

On October 24, 1890 A. P. Wilson (under his contract No. 555) set a post 4" square, 4 ft. long, 24" in the ground for the 1/4 corner. Post was marked "1/4 S" on West face.

Two bearing trees were marked:

- 14" Fir, S09 1/2°W, 25 lks. Mkd. "1/4 S BT"
- 10" Fir, N87°E, 26 lks. Mkd. "1/4 S BT"

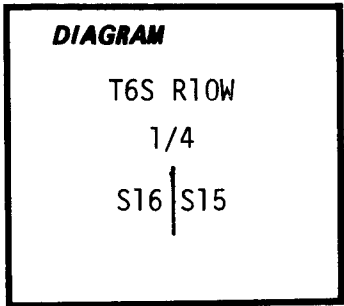

Description of corner evidence found:

Found 1" iron pipe at corner position. Pipe was apparently set by the State Highway Department in 1930 (C.S. F27-23). Said C.S. map shows a tie of S72°26'E, 397.5 ft. from what appears to be the centerline PI of a curve with a PC Station of 362 + 97.6.

Bearing trees found:

- 22" Fir Stub, S09 1/2°W, 16.5 ft. slope to face (25 lks.)  
Chopped out face and found reverse scribe of "BT" - Original BT
- 36" Hemlock, S40°E, 4.6 ft. (4.0 ft.) - Healed face (C.S. A-1205)
- 38" Fir, N10°E, 46.6 ft. (47.0 ft.) - Healed face (C.S. A-1205)

Description of monument and accessories established to perpetuate the original location of this corner:

Replaced found pipe with 2" X 30" aluminum pipe with 3" aluminum cap (with magnet under the cap). Buried found pipe alongside cap.

T6S R10W  
1/4  
S16 | S15  
LS 1084  
1988



Office of..... Surveyor..... County of..... Tillamook  
 State of..... Oregon....., I hereby certify that the within instrument was filed in this office  
 for record on the 13<sup>th</sup> day of..... July....., 1988.  
*Allan E. Duncan* by.....  
 (COUNTY OFFICIAL) (DEPUTY)