

REWITNESSED CORNER FOR STATE OF OREGON - DEPARTMENT OF FORESTRY

Section corner common to Sections 2, 3, 10 and 11, T2S, R7W, W.M.,  
Tillamook County, Oregon.

ORIGINAL by Albert P. Wilson, July 20, 1891.

Post; missing.

30" Hemlock bears N71 1/2W 27 lks.; missing.

7" Hemlock bears S20 1/4W 25 lks.; missing.

6" Vine Maple bears S24E 19 lks.; missing.

26" Hemlock bears N77E 17 lks.; now remains of root crown in  
place.

RESTORATION by Walter M. Robertson LS142 November 15, 1951 (Book 2,  
page 81, Tillamook County Records).

1 1/2"x36" galvanized iron pipe with 3" bronze cap, 30" in ground;  
in mound of stone; in place.

14" Fir stub bears S85W 16.8 ft.; now a 20"x4 ft. high badly  
rotted stub, face with portions of scribes visible laying  
alongside.

78" Fir stub bears S06E 29.2 ft.; now a 78"x9' high broken  
stub with portions of scribes T2 R7 S BT visible. (Now  
bears N02W 30.0 ft.)

38" Fir snag bears N02W 30.0 ft.; now a 28"x6 ft. high badly  
rotted stub with scribes T2S R7W S11 BT 142 visible. (Now  
bears S06E 29.2 ft.)

62" Fir snag bears N71E 52.0 ft.; now a 62" badly rotted stump  
with portions of scribes T2S R7W S2 BT 142 visible.

REWITNESSED August 31, 1988

Var. 21 1/2E

From the above pipe with marks "LS1998 1988" added, and from which a:

5" Fir bears S80E 26.3 ft. to face; scribed T2SR7WS11BT.

15" Fir bears N05E 6.3 ft. to face; scribed T2SR7WS2BT.

20" Fir bears N65W 22.2 ft. to face; scribed T2SR7WS3BT.

12" Fir bears S08W 36.7 ft. to face; scribed T2SR7WS10BT.



Metal location poster on new BTs.

Also poster on 10" Alder on east edge of Bark Shanty road bears  
S76W 40.4 ft. from pipe; road bears N05E by S05E.

3/4" brass washer marked "LS1998" nailed to face of new BTs.

Present and witnessed by David B. Buchholz and Clifford R. Foster.

Rewitnessed by

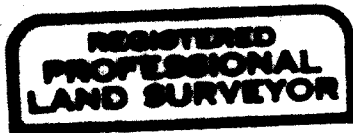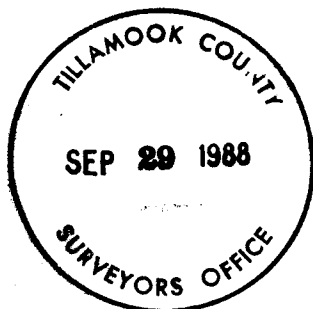

*Anthony J. Hartman*

