

County Surveyor's Record, Tillamook County, Oregon

CHAINS


Page 1

TOWNSHIP 3 SOUTH, RANGE 6 WEST

C 1/4 Corner, Section 30, T3S, R6W

(See LFCo. Map #819)

Set 1 1/4" x 36" stainless steel pipe for the corner, established by Longview Fibre Company, with a 2" brass cap marked as illustrated:

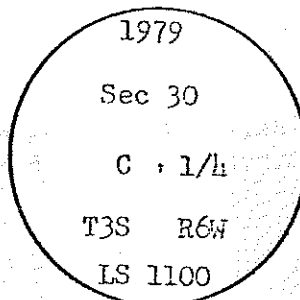

From which:

24" fir bears N 47° E 33.86 feet; scribed "C 1/4 BT S30", screw nail, lead washer, yellow aluminum section marker plate

15" fir bears S 32° W 26.91 feet; scribed "C 1/4 S30", screw nail, lead washer, yellow aluminum section marker plate

5

Aspect: Southwest

Corner is 100 feet east of road


Set by: Wesley E. Schlenker, LFCo. (LS 1100)
Witnesses: Wayne Brewer
Darlene Osborne

June 22, 1979

1/4 Corner, Sections 30/29, T3S, R6W

(See LFCo. Map #819)

Found BLM iron post, 3 feet long, 1 inch diameter, 28 inches in the ground, for the corner with brass cap marked as illustrated:

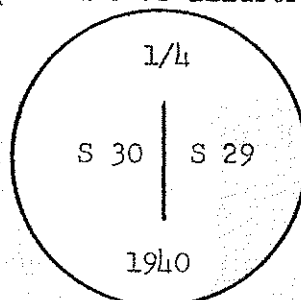

From which found:

Fir bears S 34° E 59 links

Fir bears N 30° W 59 links

Found by: Wesley E. Schlenker, LFCo. (LS 1100)
Witnesses: Wayne Brewer,
Darlene Osborne

June 22, 1979