

RESTORED CORNER FOR STATE OF OREGON - DEPARTMENT OF FORESTRY

Witness one quarter corner common to Sections 4 and 9, T2N, R7W, W.M., Tillamook County, Oregon.

ORIGINAL By Henry Meldrum July 31, 1893.

16"x8"x7" basalt stone; missing.

6" Hemlock bears S60°W 21 lks.; missing.
10" Hemlock bears N80°E 49 lks.; now a 14" badly rotted windfall, axe work visible on burnt out face.
2 lk. Creek course N80°E bears N89°42'E 120 lks.; in place.
5 lk. Creek course North bears N89°42'E 300 lks.; in place.


NOTE: Area around corner is badly torn up by old road construction and logging. True corner point falls in large log jam and nearest location for witness corner is to the north of corner point.

RESTORED August 5, 1987 Var 21 1/2°E
Set 1 1/2"x30" Aluminum pipe with 3 3/4" cap marked "STATE OF OREGON DEPARTMENT OF FORESTRY WC T2N R7W 1/4 S4 S9 South 20FT. 1987 LS1998", 28" in ground, in mound of rock, and from which a:

20" Fir bears N06°W 53.3 ft. to face; scribed XBT.
11" Alder bears N83°E 16.8 ft. to bark scribes; XBT.

Metal location poster on new BTs.
Also brass washers marked "LS1998" on new BTs.
4"x4"x72" white painted Cedar post bears S52°E 1.7 ft. from pipe.
Present and witnessed by David B. Buchholz and Clifford R. Foster.

Restored by

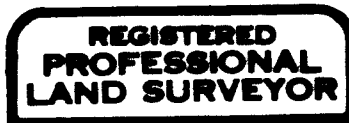

Anthony J. Klosterman

