

REWITNESSED CORNER FOR OREGON DEPARTMENT OF FORESTRY  
4907 Third St., Tillamook, Oregon 97141

Section corner common to Sections 17,18,19 and 20, T1N, R6W, W.M.,  
Tillamook County, Oregon.

ORIGINAL by John A. Hulburt, October 4, 1874.

30" x 10" x 6" stone, 12" in ground with 5 notches on East and  
3 notches on South sides; found with notches, out of place, on  
north side of Amort's pipe.

7" Hemlock bears N06°E 13 lks.; missing.

24" Hemlock bears S70°E 16 lks.; now a 6' high badly rotted  
and burnt stub with no face or scribes visible.

RESTORATION by Louis W. Amort RE2311 November 17, 1952 (Book 2,  
page 228, Tillamook County Records).

1 1/2"x36" galvanized iron pipe with 3" bronze cap, 30" in  
ground, in mound of stone; in place.

35" Fir stump bears N45°E 106.0 ft.; now 4' high and rotted  
with portions of scribes TN R6W S17 BT visible.

50" Fir stump bears S47°E 82.5 ft.; now 36" x 3' high and  
badly rotted with scribes T1N R6W S20 BT RE2311  
visible.

54" Fir stump bears S48°W 100.7 ft.; now 4' high and badly  
rotted with scribes T1N R6W S19 BT visible.

REWITNESSED October 5, 1998

Var. 19½°E

From the above pipe with marks "LS1998-1998" added, a:

12" Fir bears N88°E 5.2 ft. to face; scribed T1NR6WS17BT.

13" Fir bears S01°E 24.8 ft. to face; scribed T1NR6WS20BT.

18" Fir bears S40½°E 55.7 ft. to face; scribed T1NR6WS19BT.

12" Fir bears N48°E 13.65 ft. to face; scribed T1NR6WS18BT.


3/4" brass washer marked "LS1998" nailed to face of new BTs.

Metal location poster on new BTs.

6 ft. Orange carsonite post bears N36°E 2.1 ft.

Present and witnessed by Clifford R. Foster.

Rewitnessed by David B. Buchholz under my direction.  
David B. Buchholz, ES2272

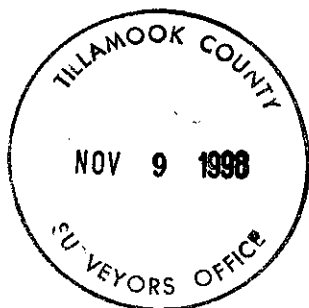

SURVEYED BY:

REGISTERED  
PROFESSIONAL  
LAND SURVEYOR

*Anthony J. Klosterman*

OREGON  
July 21, 1982  
Anthony J. Klosterman  
1998

4907 THIRD STREET  
TILLAMOOK, OR 97141  
EXPIRES JUNE 30, 1999