

RESTORED CORNER FOR OREGON DEPARTMENT OF FORESTRY  
4907 Third St., Tillamook, Oregon 97141

Section corner common to Sections 3, 4, 9 and 10, T2N, R9W, W.M.,  
Tillamook County, Oregon.

ORIGINAL by Henry Meldrum, July 28, 1884.  
18" x 8" x 8" Basalt stone 12" in ground; missing.

- 10" Hemlock bears N41°E 95 lks.; missing.
- 54" Spruce bears S39°E 72 lks.; now a 8 ft. high badly rotted  
stump with portions of scribes and axe work visible.
- 6" Vine Maple bears S38°W 23 lks.; missing.
- 4" Vine Maple bears N62°W 20 lks.; missing.


REFERENCED: A 1910 Hammond Lumber Company engineers topographic map (B-  
1540 Tillamook County Records) shows the corner to be a stone with a 54"  
Spruce BT and a bench mark on a 96" Spruce with no bearing or distance.

RESTORED by David B. Buchholz LS2272, August 23, 1994, Book 7, Page 198  
Tillamook County Records.

NOTE: Corner set from BT face which is consistent with other corners  
found in this township.

1½" x 30" Aluminum pipe with 3 ¾" bronze cap 27" in ground, in  
mound of stone; found aluminum pipe and cap out of place and  
buried due to road relocation, also found possible unrecorded  
restoration during excavation consisting of a 1" x 26" iron  
pipe.

- 19" Alder bears S58½°E 39.6 ft.; now 18" with bark scribes  
T2NR9WS10BT visible.
- Hammonds 96" Spruce: A 75" x 9 ft. high badly rotted stump  
Spruce stump bears S22°E 27.5 ft. to an apparent face  
with axe work visible; now in same condition.
- 36" Cedar bears N86°W 70.6 ft.; now 38" with scribes NRSBT  
visible on partially closed face.
- 15" Alder bears N18½°W 1.5 ft.; missing due to road  
relocation.
- Centerline of Anderson Creek Grade Road bears North 29.5  
ft. course S74°E by N74°W. See below.

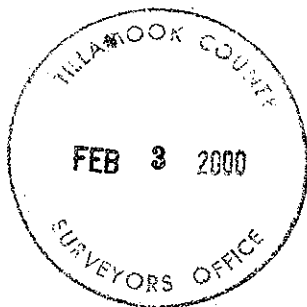

SHEET 1 of 2

RESTORED December 21, 1999

Var.  $18\frac{1}{2}^{\circ}$ E


Removed aluminum pipe from area and at the intersection of distances from the original 54" Spruce, Hammonds 96" Spruce and the 1994 36" Cedar: Set a  $1\frac{1}{2}$ " x 40" galvanized iron pipe with  $3\frac{3}{4}$ " bronze cap marked "T2NR9WS4S3S9S10 1999 LS2272 38" in ground, and from which a:

The 1994 19" Alder is now 39.32 ft. distant.  
The above mentioned 1" x 26" iron pipe bears  $N56\frac{1}{2}^{\circ}$ E 3.1 ft.  
now driven 4" below surface.  
Centerline of Anderson Creek Grade Road bears North 23.4 ft.  
course  $S86^{\circ}$ E by  $N86^{\circ}$ W.  
6 ft. orange carsonite post bears SE 1.5 ft.

1994 Metal location posters on 19" Alder and 36" Cedar BTs.  
Present and witnessed by Clifford R. Foster.

Restored

SHEET 2 of 2

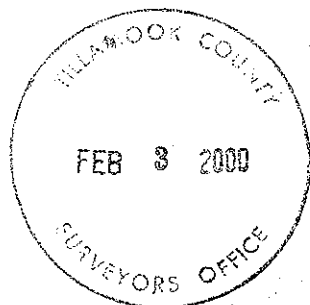

SURVEYED BY:

REGISTERED  
PROFESSIONAL  
LAND SURVEYOR

*David B. Buchholz*

OREGON  
July 16, 1987  
David B. Buchholz  
2272

4907 Third Street  
TILLAMOOK, OR 97141  
EXPIRES DECEMBER 31, 2001

BOOK 7 313