

REWITNESSED CORNER FOR OREGON DEPARTMENT OF FORESTRY
4907 Third St., Tillamook, Oregon 97141

One quarter corner common to Sections 18 and 19, T2N, R7W, W.M.,
Tillamook County, Oregon.

ORIGINAL by Henry Meldrum, September 18, 1891.

16"x9"x8" basalt stone, 11" in ground with 1/4 on North face;
missing, point falls on South edge of old road.

18" Hemlock bears S55°E 59lks.; missing.

8" Hemlock bears N06°W 21 lks.; missing.

RESTORATION by Louis W. Amort RE2311, December 17, 1952 (Book 2,
page 223, Tillamook County Records). A witness corner was set as
point for 1/4 corner would fall on edge of proposed logging road.

NOTE: Meldrum's 18" Hemlock BT was found in May, 1951, but missing
in 1952. Corner point was determined by a metal location poster
placed on a 38" burnt Hemlock stub N18°W 20.0 ft. by Oregon Depart-
ment of Forestry, May, 1951; now missing.

WITNESS CORNER

1½"x36" galvanized iron pipe with 3" bronze cap, 30" in ground,
in mound of stone 10 ft. West of corner point; missing, destroyed
by roadwork.

68" Fir stump bears S30°E 137.0 ft.; now 3 foot high and
rotted with axe work visible.

56" Fir snag bears N58½°W 83.3 ft.; now a 4 foot high badly
rotted stump with no apparent face.

Metal location poster on 33" Fir snag which bears N88°E
33.1 ft.; now a 40"x3½ ft. badly rotted stump, poster
missing.

NOTE: Scribe marks destroyed by Louis W. Amort RE2311, March 24, 1954.

RESTORATION by Louis M. Amort RE2311, March 24, 1954 (Book 1, page
121, Tillamook County Records).


At true corner point, set 1½"x24" galvanized iron pipe with 3"
bronze cap, 20" in roadbed, in mound of stone; in place and buried
by 2.9 ft. of bank slough.

52" Fir stump bears S45¼°E 144.4 ft.; now 3 foot high and
badly rotted with scribes 1/4S19BTRE23 visible.

33" Fir snag bears N86½°E 23.0 ft.; now a 40"x3½ ft. badly
rotted stump with no apparent face visible.

4"x5"x80" white painted Cedar post 1.0 ft. East of pipe;
now bears S70°E 1.0 ft.

Sheet 1 of 2

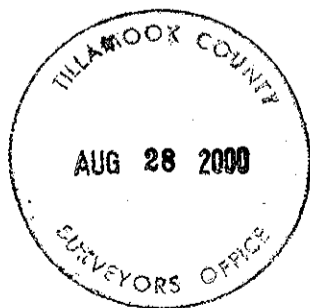

SURVEYED BY:

REGISTERED
PROFESSIONAL
LAND SURVEYOR

Anthony J. Klosterman

OREGON
July 21, 1982
Anthony J. Klosterman
1998

4907 THIRD STREET
TILLAMOOK, OR 97141
EXPIRES JUNE 30, 2001

REWITNESSED August 3, 2000

Var. $18\frac{1}{2}^{\circ}$ E

From above pipe with marks "LS1998-2000" added a:

23" Fir bears $N11\frac{1}{2}^{\circ}$ E 72.6 ft. to face; scribed 1/4S18BT.
15" Fir bears $S09\frac{1}{2}^{\circ}$ E 37.0 ft. to face; scribed 1/4S19BT.
10" Fir bears $S62^{\circ}$ W 8.1 ft to face; scribed 1/4S19BT.

Metal location poster on new BTs.


3/4" brass washer marked "LS1998" nailed to face of new BTs.

Placed a $1\frac{1}{2}$ "x3"x96" steel post on corner pipe and backfilled with stone.

Present and witnessed by Clifford R. Foster, Chris R. Woodward and Neal A. Bond.

Rewitnessed by David B. Buchholz under my direction.
David B. Buchholz, LS2272

Sheet 2 of 2

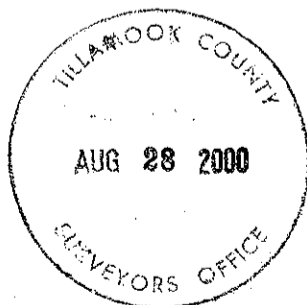

SURVEYED BY:

REGISTERED
PROFESSIONAL
LAND SURVEYOR

Anthony J. Klosterman

OREGON
July 21, 1982
Anthony J. Klosterman
1998

4907 THIRD STREET
TILLAMOOK, OR 97141
EXPIRES JUNE 30, 2001