
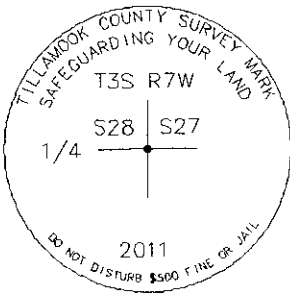


OREGON PUBLIC LAND CORNER REPORT / RESTORATION REPORT
Tillamook County Surveyor's Office

SECTION: West 1/4 27	TOWNSHIP 3 South	RANGE 7 West
COUNTY: Tillamook		DATE: 8-12-11
CORNER DESIGNATION: The Quarter Corner common to Section 27 and 28 T. 3 S., R. 7 W., W.M.	(Please check one)	
	<input type="checkbox"/>	Condition Report Only
	<input type="checkbox"/>	Restoration
	<input checked="" type="checkbox"/>	Rewitness
	<input type="checkbox"/>	Unrecorded
	<input type="checkbox"/>	Reset at surface
<input type="checkbox"/> Referenced Out		
Previous Rewitnesses, Restorations and Surveys, etc: BLM Field Notes Volume: OR-R0118 Page 755, (GLO Book 3S7 Page 10) (1873), Map B-590 (1968), Rewitness Book 3, Page 293 (1969), Tillamook County Survey Records.		
Found Monument(s) and Accessories (Condition & Source): Found an original G.L.O. 18" X 18" X 6" Stone in place, with a "1/4" chiseled on the west face and an "X" chiseled in the top. Referenced out the stone and set a 3" dia. Tillamook County Brass Cap on a 1 1/2" X 36" Iron Pipe in its place. Monument is stamped as shown hereon. We packed the Stone out and stored it in the Tillamook County Surveyor's Office for preservation. Found a rotten white painted cedar post lying next to the monument. (Book 3, Page 293) – Found 24" Hemlock Snag (was 20"), (bears S 47 1/2° E 26.2') healed face and yellow metal location tag. (Book 3, Page 293) – Found 22" Hemlock (was 15"), (bears S 12 1/2° W 37.4'), healed face and yellow metal location tag. () Indicates record information, Tillamook County Survey Records.		
Monument Set (Procedures and Description): Using the record Bearing Trees I set up over the found original stone and positioned the instrument at record distance to find the chiseled "X" in the top of the stone. I then set two nails as a distance/distance reference. We used the nails to set the new Tillamook County Brass Cap and verified the Bearing Trees for record.	Sketch of Set Monument: 	
New Accessories set: Set 120 lbs. of concrete in a 12" diameter cylinder around set monument. Set 72" hat section post South 3.0' from monument.		
New Bearing Trees Marked: * 35" dia. Hemlock bears N 56°30' W 21.7', scribed "T3S R7W S28 BT", tagged and painted. * 55" dia. Fir bears S 57° W 67.6', scribed "T3S R7W S28 BT", tagged and painted. * Indicates an aluminum nail with a washer marked, "Till. Co. Surveyor" set in face between the scribed "B" and "T" and a yellow metal location tag affixed.		
Location & Comments: Monument is located approx. 100' west of Nestucca River Road.		
Firm / Agency Address: TILLAMOOK COUNTY SURVEYOR'S OFFICE 201 Laurel Avenue Tillamook, Oregon 97141		SURVEYOR'S SEAL
Party Chief: Joe Jensen, P.L.S. 60067, Deputy County Surveyor		
Notes: Digital images were taken of the monument and its accessories. Accessories were tied with a Topcon GPT 3005 Total Station.		
Witnesses: Danny R. McNutt, P.L.S. 49230, Tillamook County Surveyor Michael R. Rice, L.S.I. 16723, Survey Technician		

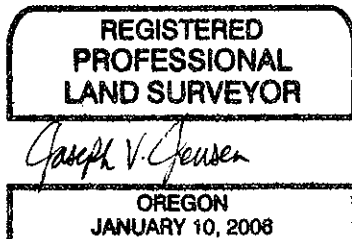