


OREGON PUBLIC LAND CORNER REPORT / RESTORATION REPORT
Tillamook County Surveyor's Office

SECTION: The West one-quarter corner of Section 14	TOWNSHIP 1 South	RANGE 9 West
COUNTY: Tillamook		DATE: 10-17-11
CORNER DESIGNATION: The West one-quarter corner for Section 14 Township 1 South, Range 9 West, W.M., Tillamook County, Oregon.		(Please check one)
		<input type="checkbox"/> Condition Report Only
		<input type="checkbox"/> Restoration
		<input checked="" type="checkbox"/> Rewitness
		<input type="checkbox"/> Unrecorded
Previous Rewitnesses, Restorations and Surveys, etc: BLM Land Status and Cadastral Survey Records Field Note Volume: OR-R0575 Pages: 215-216; Map A-1100, B-530, B-979, Tillamook County Survey Records.		<input type="checkbox"/> Reset at surface
Found Monument(s) and Accessories (Condition & Source): Found a 3" diameter B.L.M. brass cap upright and in good condition. I placed a 12" diameter plastic cylinder and 120 pounds of concrete around the monument. The monument is stamped as shown hereon. Found a 30" diameter dead Douglas Fir tree with a double face and visible scribing "1/4 S 14" at record position. Set a nail and aluminum washer stamped "TILL.CO.SURVEYOR" between the '4' and the 'B' which bears S 63-1/2° E and 2.6' from the found monument (was a 30" fir bearing S 63-1/2° E, 7-1/2 links scribed "1/4 S14 BT – BLM Volume OR-R0575 Pages 215-216). Found a 50" diameter Douglas Fir tree with a healed face and a yellow metal location tag record position (was a 50" fir bearing N 36° E, 29-1/2 links scribed "1/4 S14 BT – BLM Volume OR-R0575 Pages 215-216).		<input type="checkbox"/> Referenced Out
Monument Set (Procedures and Description): Not applicable.	Sketch of Found Monument: 	
New accessories: Set a hat section post North 3.0'.		
New Bearing Trees set: No new bearing trees were set.		
Location & Comments: This corner is located approximately 50' North and up a very steep rock face from an existing logging road.		
Firm / Agency Address: TILLAMOOK COUNTY SURVEYOR'S OFFICE		SURVEYOR'S SEAL <div style="border: 1px solid black; padding: 5px; display: inline-block;"> REGISTERED PROFESSIONAL LAND SURVEYOR <i>Joseph V. Jensen</i> OREGON JANUARY 10, 2006 JOSEPH V. JENSEN 60067 RENEWAL DATE: 08-30-2013 </div>
Party Chief: Joe Jensen, PLS 60067, Survey Supervisor and Deputy County Surveyor		
Notes: Digital images were taken of the monument and accessories.		
Witnesses: Danny R. McNutt, PLS 49230, Tillamook County Surveyor; Michael R. Rice, L.S.I. 16723, Survey Technician		

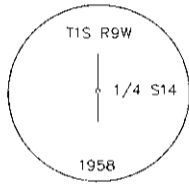